

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53762	Main Street: W_W_T_HARRIS_BV	Cross Street: SINGH_DR	Location: SE
ADA ID: AA0307F00C07	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

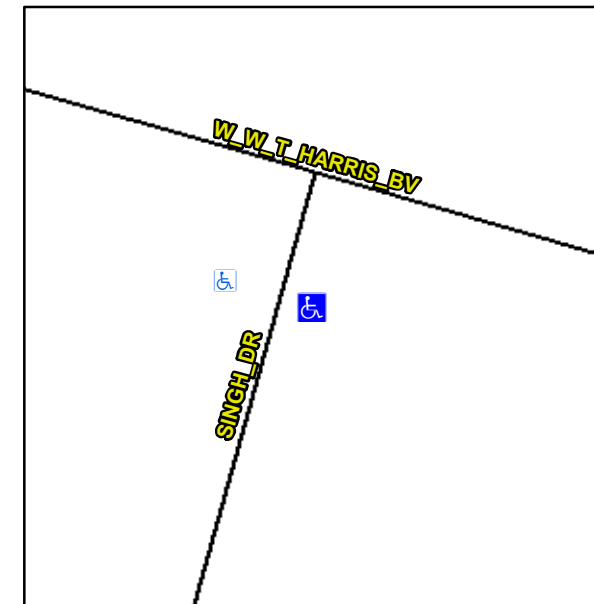

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

NO LNDG, NO SWs

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-
Para, R304.5.3, R304.5.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	76.0	No	Grade Break?	No
Yes	Ramp Width (in)	62.0	N/A	Grade Break Slope (%)	5.7
Yes	Ramp Slope (%)	5.1	N/A	Grade Break XSlope (%)	1.0
Yes	Ramp XSlope (%)	0.6			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	1.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	32.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.5
N/A	Painted X Walk1?	No		Road Slope (%)	0.3
	X Walk 1 Direction	To W		Road X Slope (%)	4.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	0.3	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	1.1

Total Cost: \$ 2350.00

