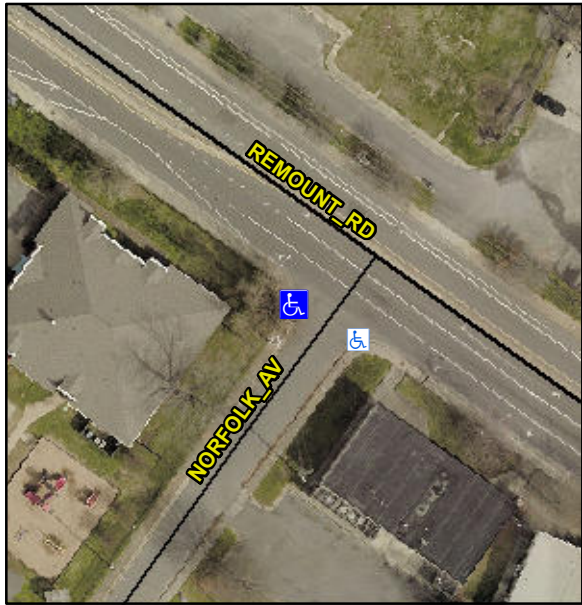


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14672	Main Street: NORFOLK_AV	Cross Street: REMOUNT_RD	Location: W
ADA ID: AA32F22DCB41	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 28.75			

	Possible Solutions:			Compliance			Description			Data	Compliance			Description			Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			N/A	Ramp Length (in)			59.0	No	Ramp Slope (%)			10.2				
				Yes	Ramp Width (in)			48.0	No	Ramp XSlope (%)			3.7				
				N/A	Flare Type LT			N/A	N/A	Flare Type RT			N/A				
				N/A	Flare Slope LT (%)			N/A	N/A	Flare Slope RT (%)			N/A				
				N/A	Flare Traversable LT?			N/A	N/A	Flare Traversable RT?			N/A				
				N/A	Landing Length (in)			N/A	N/A	DWS Provided?			N/A				
				N/A	Landing Width (in)			N/A	N/A	DWS Contrast?			N/A				
				N/A	Landing Slope (%)			N/A	N/A	DWS Length (in)			N/A				
				N/A	Landing X Slope (%)			N/A	N/A	DWS Full Width?			N/A				
Surveyor Notes:			N/A	Landing Curb? (Y/N)			N/A	N/A	DWS Offset (in)			N/A					
PROW/ADA:				Shared Landing?			N/A										
R304.2.2, R304.5.3, R302.7			N/A	Gutter Ponding?			N/A	N/A	Gutter Slope (%)			N/A					
			N/A	Gutter Lip Ht (in)			N/A	N/A	Gutter X Slope (%)			N/A					
			N/A	Painted X Walk1?			No	N/A	Painted X Walk2?			No					
				X Walk 1 Direction			To SE		X Walk 2 Direction			To NE					
			N/A	X Walk 1 Width (in)			N/A	N/A	X Walk 2 Width (in)			N/A					
				X Walk 1 Slope (%)			3.9		X Walk 2 Slope (%)			0.1					
				X Walk 1 X Slope (%)			2.0		X Walk 2 X Slope (%)			4.0					
Street 1 Name			NORFOLK AV	Ramp inside XWalk1?			N/A	N/A	Ramp inside XWalk2?			N/A					
Stop Condition-Street 2			StopSign	Road Slope (%)			6.2	N/A	Clear Space?			N/A					
Street 2 Name			REMOUNT RD	Road X Slope (%)			3.1	N/A	Clear Space to XWalk (in)			N/A					
Stop Condition-Street 1			None	Any Obstructions?			N/A	N/A	Storm Grate/Utility Hazard?			N/A					
				Obstruction Type					Storm Grate/Utility Type								
							N/A					N/A					
							No		Surface Condition? (G/P)			Poor					

