


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9823	Main Street: CONCORDIA_AV	Cross Street: GRIMES_ST	Location: W
ADA ID: AA546D157E10	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 7.5
			Field Measurements/Component Compliance

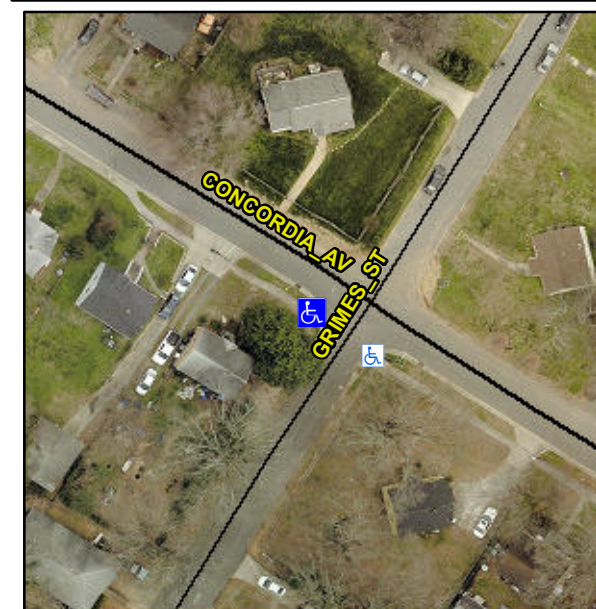

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.3, R305.1.4, R305.2, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	120.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	57.0	No	Grade Break Slope (%)	6.7
Yes	Ramp Slope (%)	7.5	No	Grade Break XSlope (%)	2.2
Yes	Ramp XSlope (%)	1.7			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	57.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	2.0	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	48.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	8.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No		Road Slope (%)	2.8
	X Walk 1 Direction	To SE		Road X Slope (%)	1.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.1

Total Cost: \$ 2350.00

