

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 6611	Main Street: N_TRYON_ST	Cross Street: W_ROCKY_RIVER_RD	Location: E
ADA ID: AA7BE144751B	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

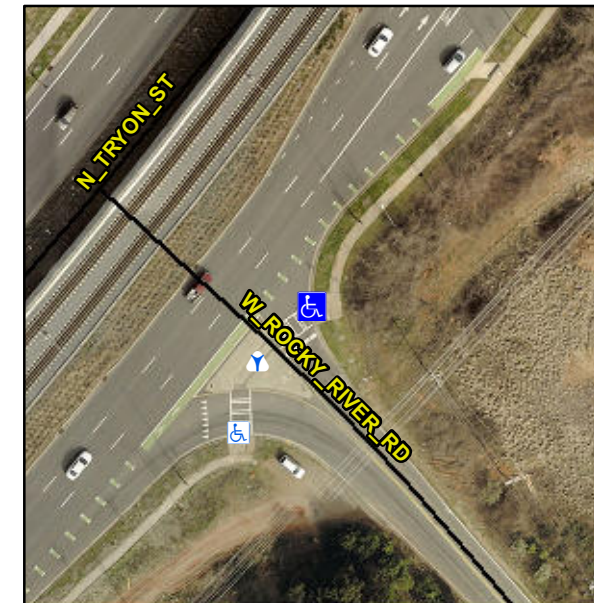

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	97.0	Yes	BlendTrans Slope (%)	4.5
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.8	N/A	Flare Slope RT (%)	4.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	113.0
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	1.4
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	0.3
N/A	Ramp inside XWalk1?	N/A	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.0		Clear Space?	Yes
	Road X Slope (%)	0.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	16.2

Street 1 Name N TRYON ST

Stop Condition-Street 1 None

Street 2 Name W ROCKY RIVER RED

Stop Condition-Street 2 StopSign

