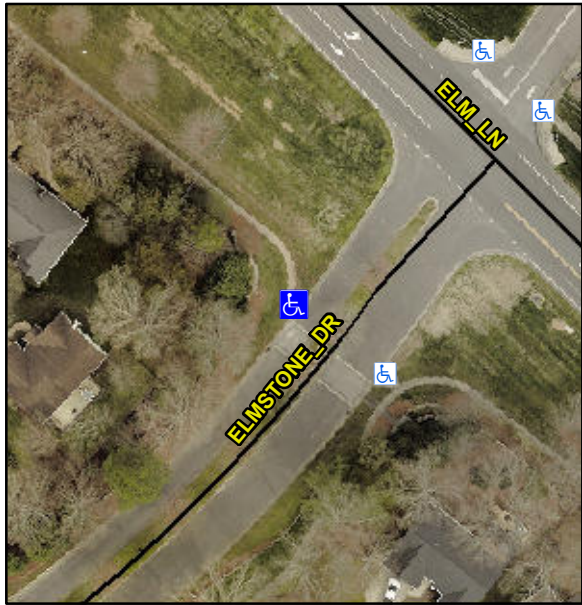


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10025998	Main Street: ELMSTONE_DR	Cross Street: N/A	Location: N
ADA ID: AAED68DD4256	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 20.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	102.0	Yes	Ramp Slope (%)	5.4		
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.5		
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	8.4	Yes	Flare Slope RT (%)	5.7		
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes		
			No	Landing Length (in)	N/A	No	DWS Provided?	No		
			No	Landing Width (in)	N/A	N/A	DWS Contrast?	No		
			No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
			No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No		
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A		
PROW/ADA:		Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7	N/A	Shared Landing?	No					
			No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	3.3		
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5		
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
				X Walk 1 Direction	To SE		X Walk 2 Direction	N/A		
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
				X Walk 1 Slope (%)	7.1		X Walk 2 Slope (%)	N/A		
				X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	N/A		
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
				Road Slope (%)	N/A	N/A	Clear Space?	Yes		
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No		
				Obstruction Type			Storm Grate/Utility Type			
						N/A		N/A		
						Yes	Surface Condition? (G/P)	Good		

Street 1 Name	ELMSTONE DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost:	\$	1850.00
-------------	----	---------

