

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: 7TH_ST	Cross Street: N/A	Location: SW
ADA ID: AB07C14E180D	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

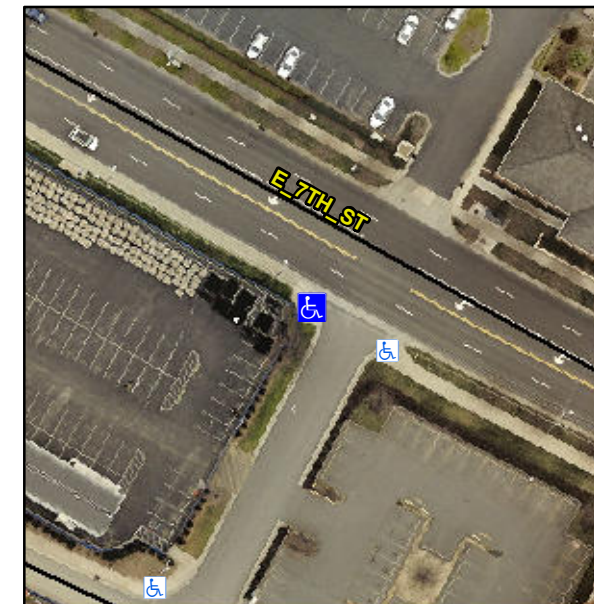

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3**

Total Cost:

**\$ 3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	60.0	Yes	Ramp Slope (%)	5.7
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.8	Yes	Flare Slope RT (%)	1.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.1	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	3.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.3		X Walk 2 Slope (%)	7.3
	X Walk 1 X Slope (%)	4.4		X Walk 2 X Slope (%)	0.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.4	N/A	Clear Space?	Yes
	Road X Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **ENTRANCE**

Stop Condition-Street 2 **StopSign**

Street 2 Name **7TH ST**

Stop Condition-Street 1 **None**

