


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13871	Main Street: E_5TH_ST	Cross Street: HAWTHORNE_LN	Location: W
ADA ID: AB3715A260EC	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

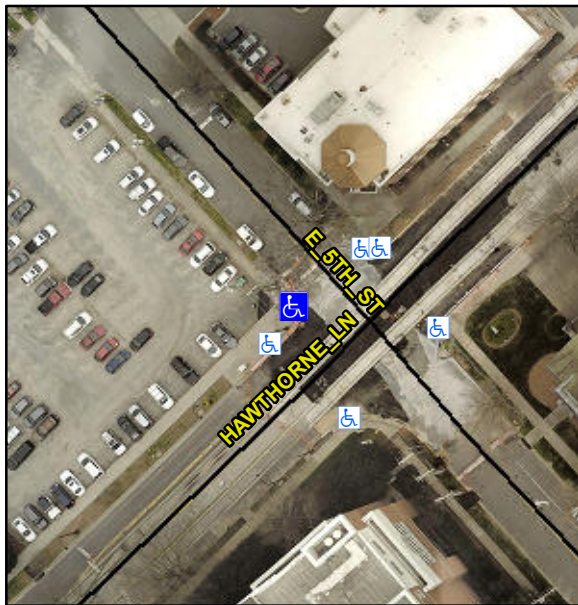

Possible Solutions:

Remove & Replace Curb Slope and Extend Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3

Total Cost: \$ 2750.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	74.0	Yes	BlendTrans Slope (%)	5.0
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	6.4	Yes	Flare Slope RT (%)	3.3
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	57.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.9	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	109.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.0		Clear Space?	Yes
	Road X Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	16.4

