

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 13754	Main Street: S_MCDOWELL_ST	Cross Street: BAXTER_ST	Location:	S
ADA ID: ABDE5E1006CD	Ramp Type: Combination1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

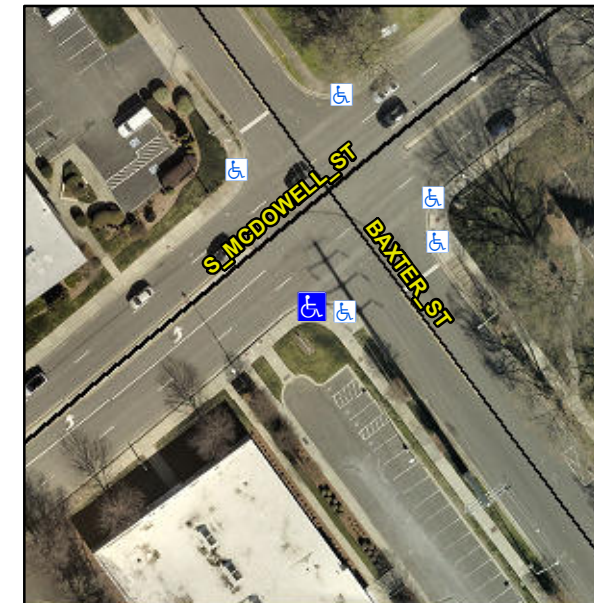

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R305.2,  
R304.5.4**

Total Cost: \$ 2550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	56.0	N/A	Ramp Length RT (in)	42.0
Yes	Ramp Width LT (in)	82.0	Yes	Ramp Width RT (in)	75.0
Yes	Ramp Slope LT (%)	7.1	Yes	Ramp Slope RT (%)	7.2
Yes	Ramp XSlope LT (%)	0.3	Yes	Ramp XSlope RT (%)	2.0
N/A	Ramp Length (in)	27.0	Yes	Ramp Slope (%)	3.2
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	6.8	Yes	Flare Slope RT (%)	2.9
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	75.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	46.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.9	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	No
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	15.3

Street 1 Name	None
Stop Condition-Street 1	S MCDOWELL ST
Street 2 Name	N/A
Stop Condition-Street 2	N/A

