


Intersection ID: 13704	Main Street: CHESTERFIELD_AV	Cross Street: THE_PLAZA	Location:	E
ADA ID: AC1B1405600B	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length (in)	55.0	No	Ramp Slope (%)	14.1
			No	Ramp Width (in)	45.5	Yes	Ramp XSlope (%)	0.5
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	N/A
PROW/ADA:		N/A	Shared Landing?	N/A				
<b>Not Found, R304.5.1, R304.2.2</b>		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	No
			X Walk 1 Direction	To NW		X Walk 2 Direction	To SW	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	3.7		X Walk 2 Slope (%)	1.2	
			X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	2.8	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	N/A
			Road Slope (%)	2.7	N/A	Clear Space?	N/A	N/A
			Road X Slope (%)	3.5	N/A	Clear Space to XWalk (in)	N/A	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	N/A
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	N/A
					Yes	Surface Condition? (G/P)	Good	Good
Total Cost:		\$ 3200.00						
Street 1 Name		THE PLAZA						
Stop Condition-Street 2		StopSign						
Street 2 Name		CHESTERFIELD AV						
Stop Condition-Street 1		StopSign						

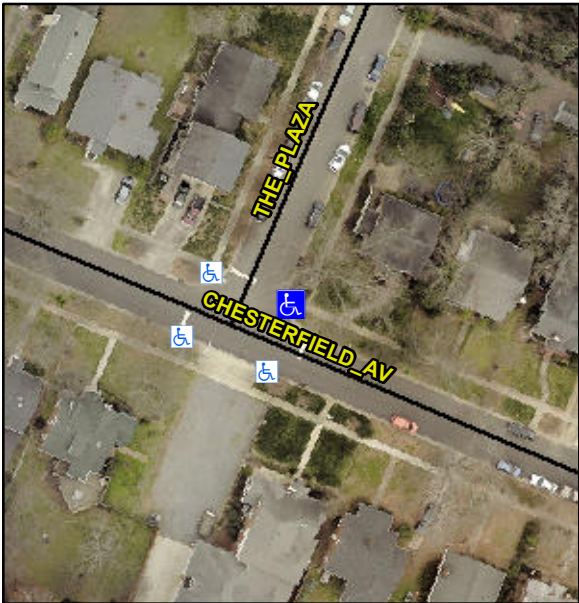