

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10016341	Main Street: UNIVERSITY_CITY_BV	Cross Street: N/A	Location: NW
ADA ID: AC1D6E4F1676	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 17.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

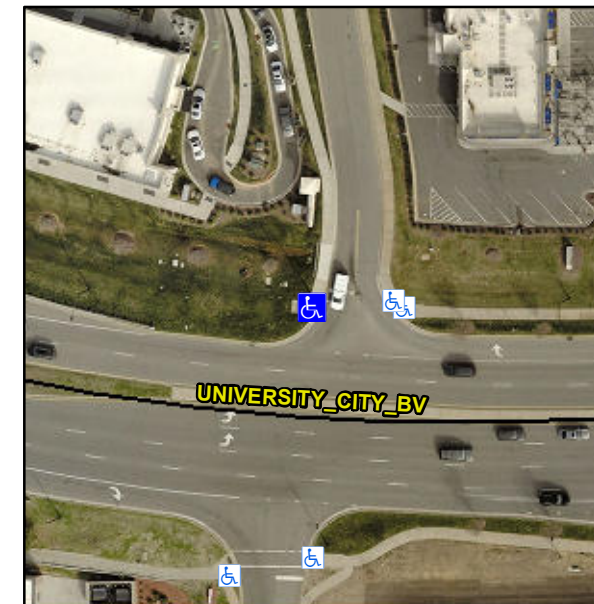

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

NO LNDG

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.2.3, R305.1.4, R305.2

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	146.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	68.0	Yes	Grade Break Slope (%)	3.7
Yes	Ramp Slope (%)	4.2	Yes	Grade Break XSlope (%)	0.7
Yes	Ramp XSlope (%)	1.2			
Yes	Flare Type LT	N/A	No	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	3.1
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	40.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	67.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No		Road Slope (%)	0.7
	X Walk 1 Direction	To E		Road X Slope (%)	0.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.4

Street 1 Name	ENTRANCE
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

