


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30460	Main Street: CRESCENT_EXECUTIVE_DR	Cross Street: MICROSOFT_WY	Location: NE
ADA ID: AC528F28C918	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

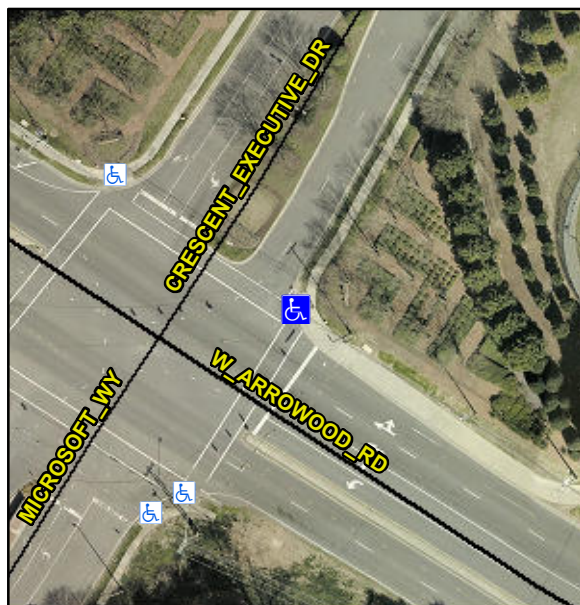

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.3, R305.1.4, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	102.0	Yes	BlendTrans Slope (%)	3.8
Yes	Ramp Width (in)	79.0	Yes	BlendTrans XSlope (%)	2.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
No	Flare Slope LT (%)	N/A	No	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	10.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.3
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
	X Walk 1 Width (in)	110.0		X Walk 2 Width (in)	109.0
	X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	1.4
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	3.3
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	2.4		Clear Space?	Yes
	Road X Slope (%)	0.2	Yes	Clear Space to XWalk (in)	104.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	13.3

