

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 11512 Main Street: N_SMITH_ST Cross Street: W_7TH_ST Location: W

ADA ID: AD09DB3FE3BA Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 27.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

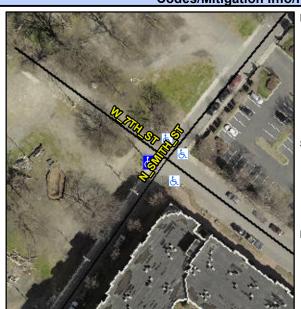

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

W 7TH ST None N SMITH ST StopSign Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R302.7

Total Cost: \$ 3200.00

Compliance Description		Data	Comp	liance	Description	Data
N/A	Ramp Length (in)	62.0	Yes	Ramp	Slope (%)	5.4
Yes	Ramp Width (in)	55.0	No	Ramp	XSlope (%)	5.4
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painte	ed X Walk2?	No
	X Walk 1 Direction	To SE		X Wa	lk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.1		X Wa	lk 2 Slope (%)	3.2
	X Walk 1 X Slope (%)	0.1		X Wa	lk 2 X Slope (%)	1.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp	inside XWalk2?	N/A
	Road Slope (%)	6.6	N/A	Clear	Space?	N/A
	Road X Slope (%)	8.8	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm	Grate/Utility Hazard?	N/A
	Obstruction Type		l	Storm	Grate/Utility Type	
		N/A				N/A

Surface Condition? (G/P)

Poor





