


Intersection ID: 30333	Main Street: NORTH PARK_MALL_DR	Cross Street: EASTWAY_DR	Location:	NE
ADA ID: ADB1134A27BD	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 27.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

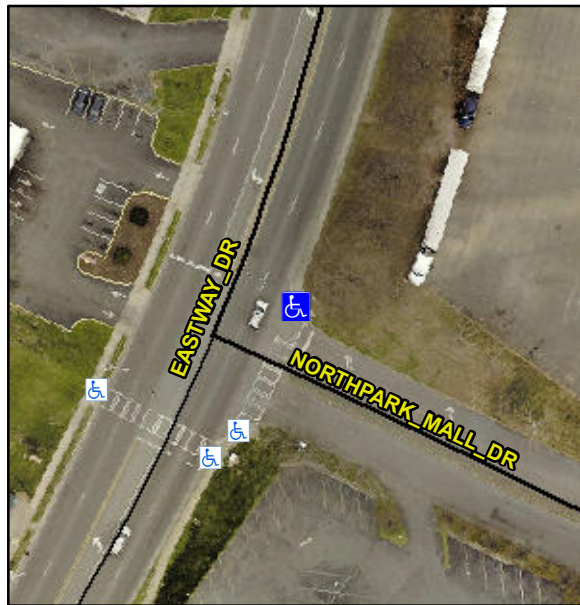

### Possible Solutions:

### Remove & Replace Entire Ramp.

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R304.2.1,  
R304.2.2-Perp, R304.3.2-Para, R305,  
R302.7.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	70.5	Yes	Ramp Slope (%)	6.1
Yes	Ramp Width (in)	52.5	No	Ramp XSlope (%)	2.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.5	Yes	Flare Slope RT (%)	2.3
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	No	DWS Provided?	No
No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.1
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	112.5	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1850.00

Street 1 Name	<b>NORTHPARK MALL DR</b>
Stop Condition-Street 2	<b>Signal</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 1	<b>N/A</b>

