


Intersection ID: 12493	Main Street: BELVEDERE_AV	Cross Street: WINTER_ST	Location:	SE
ADA ID: AE0540E48EF5	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance																	
	Possible Solutions:		Remove & Replace Entire Ramp.																	
	Surveyor Notes:		N/A																	
	PROW/ADA:		R304.5.1																	
	Street 1 Name		BELVEDERE AV																	
	Stop Condition-Street 2		None																	
	Street 2 Name		N/A																	
	Stop Condition-Street 1		N/A																	
	Total Cost:		\$ 1850.00																	
			Compliance			Description			Data			Compliance			Description			Data		
			N/A			Ramp Length (in)			102.5			Yes			Ramp Slope (%)			5.2		
			No			Ramp Width (in)			45.0			Yes			Ramp XSlope (%)			2.8		
			N/A			Flare Type LT			N/A			N/A			Flare Type RT			N/A		
			N/A			Flare Slope LT (%)			N/A			N/A			Flare Slope RT (%)			N/A		
			N/A			Flare Traversable LT?			N/A			N/A			Flare Traversable RT?			N/A		
			N/A			Landing Length (in)			N/A			N/A			DWS Provided?			N/A		
			N/A			Landing Width (in)			N/A			N/A			DWS Contrast?			N/A		
			N/A			Landing Slope (%)			N/A			N/A			DWS Length (in)			N/A		
			N/A			Landing X Slope (%)			N/A			N/A			DWS Full Width?			N/A		
			N/A			Landing Curb? (Y/N)			N/A			N/A			DWS Offset (in)			N/A		
			N/A			Shared Landing?			N/A											
			N/A			Gutter Ponding?			Yes			N/A			Gutter Slope (%)			N/A		
			N/A			Gutter Lip Ht (in)			N/A			N/A			Gutter X Slope (%)			N/A		
			N/A			Painted X Walk1?			No			N/A			Painted X Walk2?			N/A		
						X Walk 1 Direction			To N						X Walk 2 Direction			N/A		
			N/A			X Walk 1 Width (in)			N/A			N/A			X Walk 2 Width (in)			N/A		
						X Walk 1 Slope (%)			4.1						X Walk 2 Slope (%)			N/A		
						X Walk 1 X Slope (%)			4.2						X Walk 2 X Slope (%)			N/A		
			N/A			Ramp inside XWalk1?			N/A			N/A			Ramp inside XWalk2?			N/A		
						Road Slope (%)			N/A			N/A			Clear Space?			N/A		
						Road X Slope (%)			N/A			N/A			Clear Space to XWalk (in)			N/A		
			N/A			Any Obstructions?			N/A			N/A			Storm Grate/Utility Hazard?			N/A		
						Obstruction Type									Storm Grate/Utility Type					
									N/A									N/A		
												Yes			Surface Condition? (G/P)			Good		

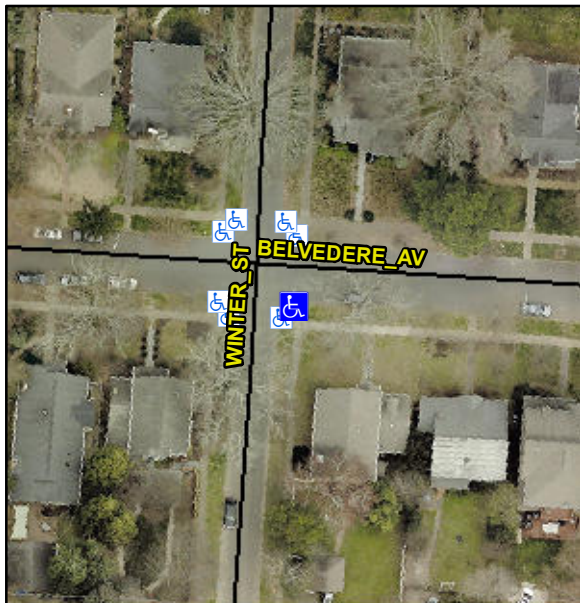