


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53713	Main Street: N_TRYON_ST	Cross Street: PERIWINKLE_HILL_AV	Location: E
ADA ID: AEB8CCF3E7A5	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

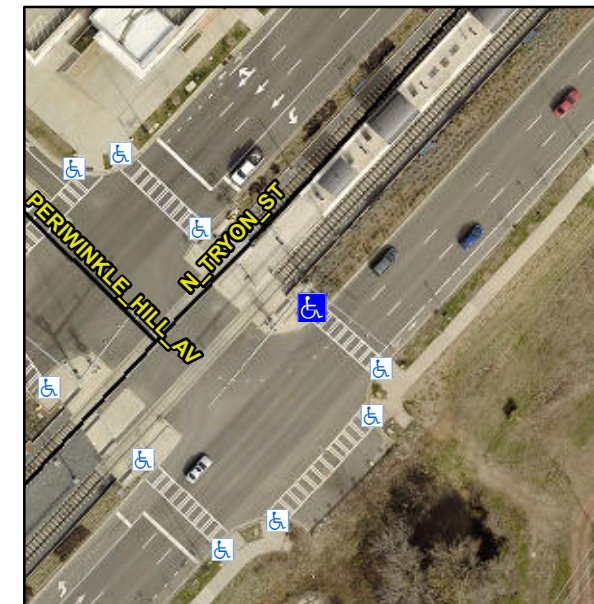

Possible Solutions:

**Remove & Replace Curbed Edge.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.2.3, R304.5.3

Total Cost: \$ 1050.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	114.0	Yes	BlendTrans Slope (%)	1.0
Yes	Ramp Width (in)	116.0	Yes	BlendTrans XSlope (%)	1.4
No	Flare Type	Curbed_WithWalkSurface	Yes	Flare Type	Curbed_NoWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	93.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	114.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.3
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	106.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.6		Clear Space?	Yes
	Road X Slope (%)	1.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	3.4

