

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12925	Main Street: S_CHURCH_ST	Cross Street: W_CARSON_BV	Location: SW
ADA ID: AED81B82C918	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

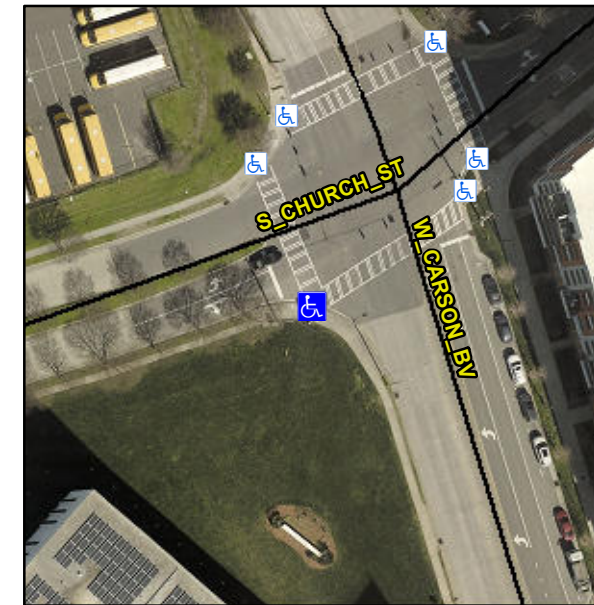

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.3.2

Total Cost:

\$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	65.0	N/A	Ramp Length RT (in)	N/A
Yes	Ramp Width LT (in)	97.0	N/A	Ramp Width RT (in)	N/A
No	Ramp Slope LT (%)	11.1	N/A	Ramp Slope RT (%)	N/A
Yes	Ramp XSlope LT (%)	1.2	N/A	Ramp XSlope RT (%)	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	112.0	N/A	X Walk 2 Width (in)	114.0
	X Walk 1 Slope (%)	2.0		X Walk 2 Slope (%)	0.9
	X Walk 1 X Slope (%)	4.2		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	4.8	N/A	Clear Space?	N/A
	Road X Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	13.3

Street 1 Name **W CARSON BV**
 Stop Condition-Street 1 **Signal**
 Street 2 Name **S CHURCH ST**
 Stop Condition-Street 2 **Signal**

