

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 30057	Main Street: SOUTHWIND_DR	Cross Street: SUNSET_VILLAGE_DR	Location:	N
ADA ID: AF29D64AF695	Ramp Type: Combination1Diag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 0

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

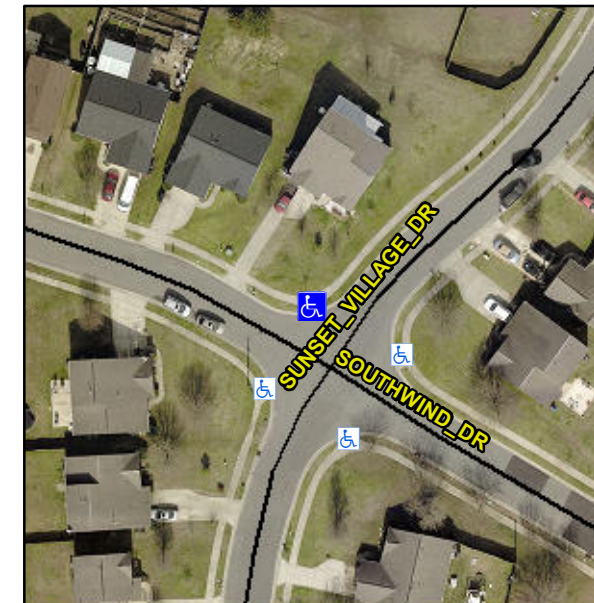

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.3.2**

Street 1 Name	<b>StopSign</b>
Stop Condition-Street 1	<b>SOUTHWIND DR</b>
Street 2 Name	<b>None</b>
Stop Condition-Street 2	<b>SUNSET VILLAGE DR</b>

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	46.0	N/A	Ramp Length RT (in)	46.0
Yes	Ramp Width LT (in)	59.0	Yes	Ramp Width RT (in)	60.5
No	Ramp Slope LT (%)	9.2	Yes	Ramp Slope RT (%)	5.0
Yes	Ramp XSlope LT (%)	1.4	Yes	Ramp XSlope RT (%)	0.4
N/A	Ramp Length (in)	55.5	Yes	Ramp Slope (%)	6.9
Yes	Ramp Width (in)	54.0	No	Ramp XSlope (%)	4.0
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	0.2
	X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	4.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.7		Clear Space?	N/A
	Road X Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	0.9

