


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48088	Main Street: MALLARD_HIGHLANDS_DR	Cross Street: JOHN_ADAMS_RD	Location: NE
ADA ID: AF56D49DE3CD	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 10.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

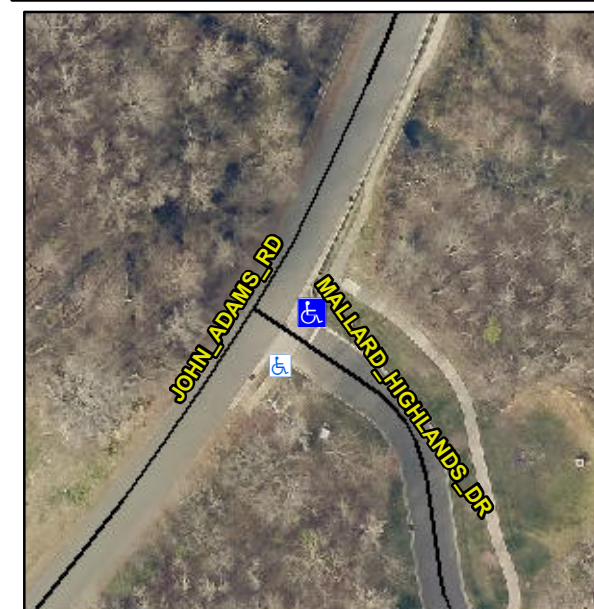

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	60.0	Yes	BlendTrans Slope (%)	0.5
Yes	Ramp Width (in)	58.0	No	BlendTrans XSlope (%)	4.3
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	52.0	No	DWS Provided?	No
Yes	Landing Width (in)	52.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	0.9	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	1.6
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	0.5
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.6		Clear Space?	Yes
	Road X Slope (%)	0.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name ADAM PLACE RD
 Stop Condition-Street 1 None
 Street 2 Name MALLARD HIGHLANDS DR
 Stop Condition-Street 2 StopSign

