


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 24035	Main Street: ECHO_FOREST_DR	Cross Street: PINEVILLE-MATTHEWS_RD	Location: S
ADA ID: AF9B7B6FC3C6	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 7.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

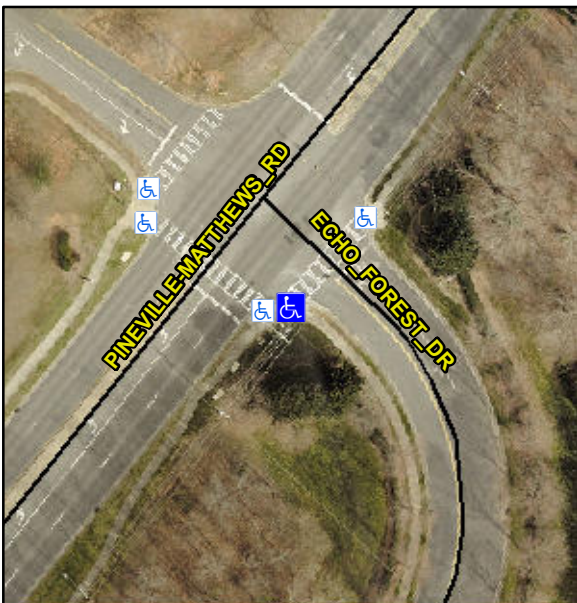

Possible Solutions:
**Remove & Replace Entire Ramp.
 Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.3, R304.2.1,
 R304.2.2-Perp, R304.3.2-Para,
 R304.2.3, R305.2, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84.0	Yes	Ramp Slope (%)	6.6
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.3	No	Flare Slope RT (%)	10.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	36.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.4	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	108.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 2600.00

Street 1 Name **ECHO FOREST DR**
 Stop Condition-Street 2 **Signal**
 Street 2 Name **N/A**
 Stop Condition-Street 1 **N/A**

