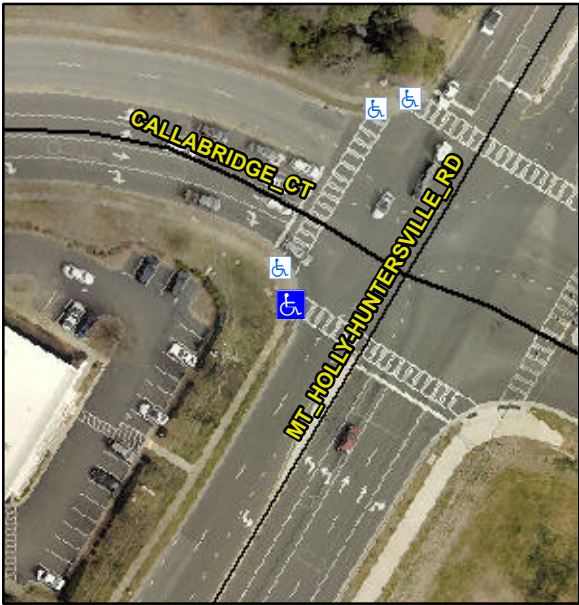


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 42379	Main Street: CALLABRIDGE_CT	Cross Street: MT_HOLLY-HUNTERSVILLE_RD	Location: W
ADA ID: AFBF714D9569	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 20.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	5.2
	Remove & Replace Gutter.		Yes	Ramp Width (in)	53.0	Yes	Ramp XSlope (%)	2.5
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	8.4	Yes	Flare Slope RT (%)	4.7
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
			No	Landing Width (in)	46.0	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	4.0	Yes	DWS Length (in)	24.0
			Yes	Landing X Slope (%)	1.7	Yes	DWS Full Width?	Yes
Surveyor Notes:		No	Landing Curb? (Y/N)	No	No	DWS Offset (in)	8.0	
N/A		N/A	Shared Landing?	No				
PROW/ADA:		Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.3	
R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7.2, R304.5.4		No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.7	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
			X Walk 1 Direction	To E		X Walk 2 Direction	N/A	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	N/A	
			X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	N/A	N/A	Clear Space?	Yes	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 2600.00						

