


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 10756	Main Street: GALWAY_DR	Cross Street: SHANNONHOUSE_DR	Location: NW
ADA ID: B00CCDF52B80	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

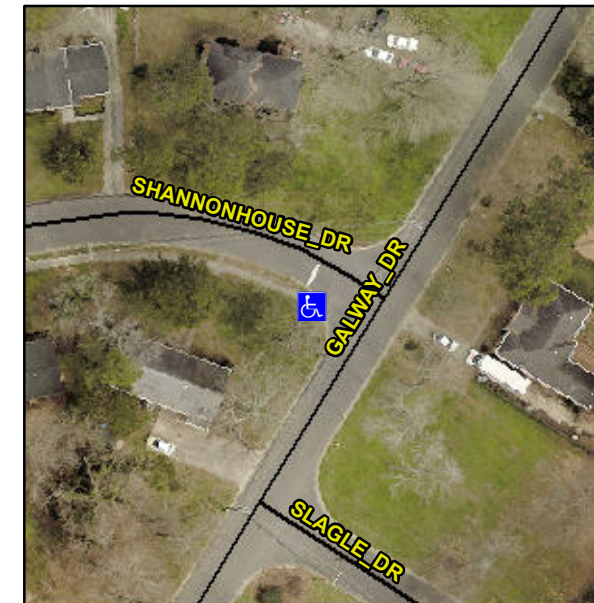

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R305.1.4, R305.2,
R304.5.4**

Total Cost: \$ 2600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	63.0	Yes	Ramp Slope (%)	5.6
Yes	Ramp Width (in)	52.0	Yes	Ramp XSlope (%)	1.9
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	Yes	Flare Slope RT (%)	6.5
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	33.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	49.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name SHANNONHOUSE DR
Stop Condition-Street 2 StopSign
Street 2 Name N/A
Stop Condition-Street 1 N/A

