

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

Intersection ID: 20942 Main Street: CORONATION BV **Cross Street: CROWN CENTRE DR** Location: SW **Overall Compliance: No** ADA ID: B01588667C73 Ramp Type: PerpDiag Initial Pass/Fail: Fail **Severity Score:** 37.5

Compliance Description

**Codes/Mitigation Info/Possible Solution** 

Field Measurements/Component Compliance

Data Compliance Description



Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1

**CORONATION BV** StopSign **CROWN CENTRE DR** None


Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes: N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Total Cost:

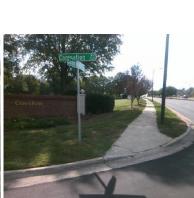

3200.00

N/A	Ramp Length (in)	52.0	No	Ramp Slope (%)	14.9
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	5.8
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	5.1
	X Walk 1 X Slope (%)	4.1		X Walk 2 X Slope (%)	4.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8	N/A	Clear Space?	N/A
	Road X Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
NAT C			Yes	Surface Condition? (G/P)	Good



