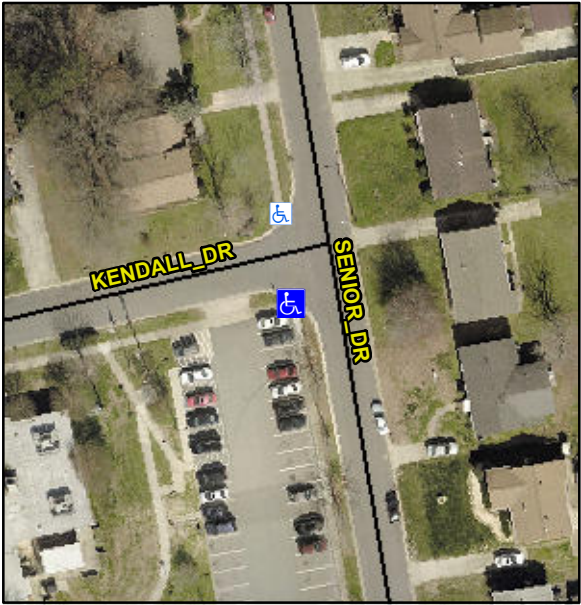


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 7848	Main Street: KENDALL_DR	Cross Street: SENIOR_DR	Location: SE
ADA ID: B03D1BE83901	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 1.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:						
	Remove & Replace Entire Ramp.						
	Surveyor Notes:  <b>N/A</b>	Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	25.5	Yes	Ramp Slope (%)	6.1
		Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.9
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
	PROW/ADA:  <b>R304.5.3</b>	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To N		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	33.5	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
Street 1 Name	KENDALL DR		Road Slope (%)	2.2	N/A	Clear Space?	N/A
Stop Condition-Street 2	StopSign		Road X Slope (%)	3.5	N/A	Clear Space to XWalk (in)	N/A
Street 2 Name	N/A		Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
Stop Condition-Street 1	N/A		Obstruction Type			Storm Grate/Utility Type	
Total Cost:		\$	1850.00		N/A		N/A
					Yes	Surface Condition? (G/P)	Good

