


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 32311	Main Street: LAUREL_WALK_CT	Cross Street: NEW_PROVIDENCE_LN	Location: NW
ADA ID: B0A2932AA10C	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

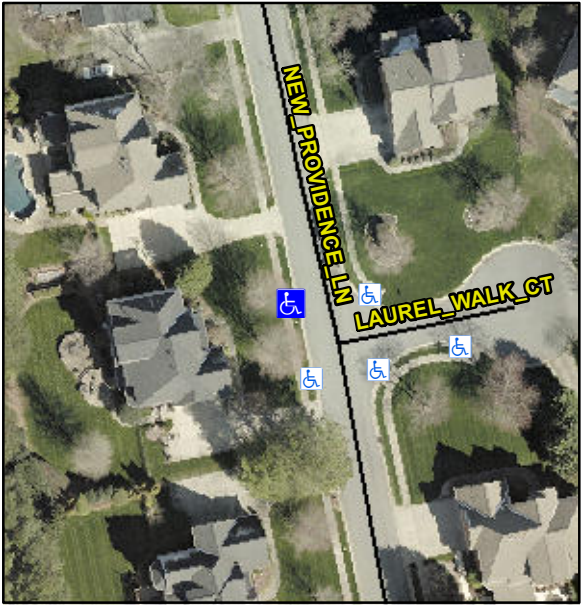

Possible Solutions:  
**Remove & Replace Entire Ramp.**

Surveyor Notes:  
**N/A**

PROW/ADA:  
**R304.2.2, R304.5.3**

Street 1 Name: **NEW PROVIDENCE LN**  
 Stop Condition-Street 2: **None**  
 Street 2 Name: **N/A**  
 Stop Condition-Street 1: **N/A**

Total Cost: \$ **1850.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	46.0	No	Ramp Slope (%)	9.2
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.2
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

