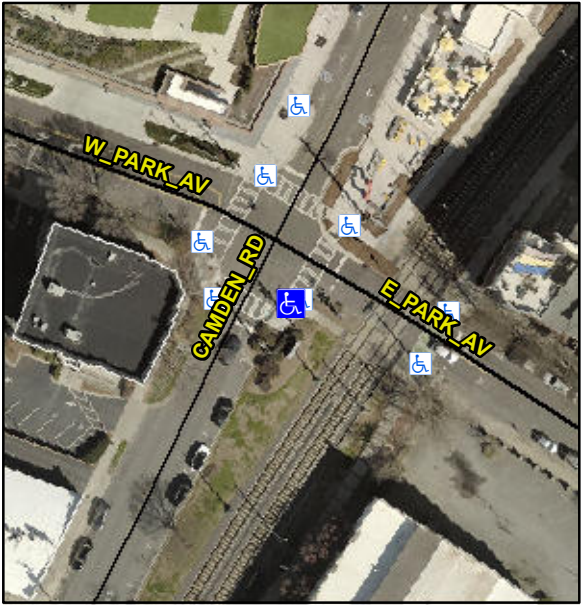


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13736	Main Street: CAMDEN_RD	Cross Street: E_PARK_AV	Location: S
ADA ID: B0D37B907355	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 0.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Gutter.		Yes	Ramp Length (in)	71.0
			Yes	Ramp Width (in)	68.0
			Yes	Flare Type L	Curbed_NoWalkSurface
			Yes	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	No
			Yes	Landing Length (in)	57.5
			Yes	Landing Width (in)	66.0
			Yes	Landing Slope (%)	1.2
			Yes	Landing X Slope (%)	0.4
Surveyor Notes: N/A PROW/ADA: R304.5.3			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	No
			Yes	DWS Provided?	Yes
			Yes	DWS Contrast?	Yes
			Yes	DWS Length (in)	24.0
			Yes	DWS Full Width?	Yes
			Yes	DWS Offset (in)	0.0
			No	Gutter Slope (%)	3.4
			No	Gutter X Slope (%)	5.5
			N/A	Painted X Walk1?	N/A
			To W	X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
			1.9	X Walk 2 Slope (%)	N/A
			2.7	X Walk 2 X Slope (%)	N/A
			Yes	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	Yes
			N/A	Clear Space to XWalk (in)	N/A
			Yes	Storm Grate/Utility Hazard?	No
			N/A	Storm Grate/Utility Type	N/A
Total Cost:		\$ 750.00	Yes	Surface Condition? (G/P)	Good

