


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48572	Main Street: MATLEA_CT	Cross Street: SALAMANDER_RUN_LN	Location: NW
ADA ID: B0FFE5CA37E0	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

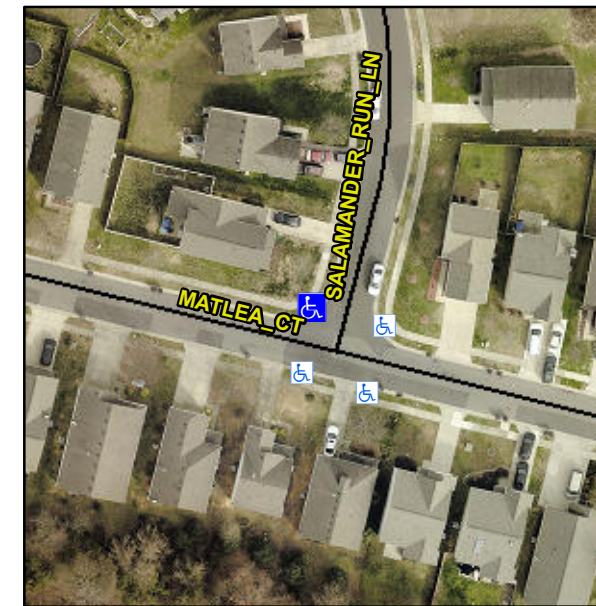

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R302.7

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.0	Yes	BlendTrans Slope (%)	4.6
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	1.3	N/A	Flare Slope RT (%)	1.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	49.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	65.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	3.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.4		X Walk 2 Slope (%)	3.6
	X Walk 1 X Slope (%)	3.3		X Walk 2 X Slope (%)	1.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.3		Clear Space?	Yes
	Road X Slope (%)	6.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	9.8

