


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 10025157	Main Street: DUCKWORTH_AV	Cross Street: N/A	Location: W
ADA ID: B109123557D0	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Entire Ramp.</b>		N/A	Ramp Length (in)	47.0	
			Yes	Ramp Width (in)	58.0	
			No	Ramp Slope (%)	9.4	
			No	Ramp XSlope (%)	4.7	
			N/A	Flare Type LT	N/A	
			N/A	Flare Slope LT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	
	Surveyor Notes:		N/A	Flare Type RT	N/A	
	<b>ACCESS AISLE RAMP</b>		N/A	Flare Slope RT (%)	N/A	
			N/A	Flare Traversable RT?	N/A	
			N/A	Landing Length (in)	0.0	
			N/A	Landing Width (in)	0.0	
			N/A	Landing Slope (%)	0.0	
			N/A	Landing X Slope (%)	0.0	
	PROW/ADA:		N/A	Landing Curb? (Y/N)	N/A	
	<b>R304.2.2, R304.5.3</b>		N/A	DWS Provided?	N/A	
			N/A	DWS Contrast?	N/A	
			N/A	DWS Length (in)	N/A	
			N/A	DWS Full Width?	N/A	
Street 1 Name	DUCKWORTH AV		N/A	DWS Offset LT (in)	N/A	
Stop Condition-Street 1	None		N/A	DWS Offset RT (in)	N/A	
Street 2 Name	N/A		N/A	DWS Slope (%)	N/A	
Stop Condition-Street 2	N/A		N/A	Gutter Slope (%)	N/A	
			N/A	Gutter Lip Ht (in)	0.0	
			N/A	Gutter X Slope (%)	N/A	
			N/A	Painted X Walk1?	No	
			N/A	Road Slope (%)	6.5	
			N/A	X Walk 1 Direction	To E	
			N/A	Road X Slope (%)	2.9	
			N/A	X Walk 1 Width (in)	N/A	
			N/A	Clear Space?	N/A	
			N/A	X Walk 1 Slope (%)	6.5	
			N/A	Clear Space to XWalk (in)	N/A	
			N/A	X Walk 1 X Slope (%)	2.9	
			N/A	Storm Grate/Utility Hazard?	N/A	
			N/A	Storm Grate/Utility Type		
			N/A	Ramp inside XWalk1?	N/A	
			N/A	Any Obstructions?	N/A	
			N/A	Obstruction Type		
			Yes	Surface Condition? (G/P)	Good	
			N/A	Curb Slope (%)	9.9	
Total Cost:		\$ 1600.00				

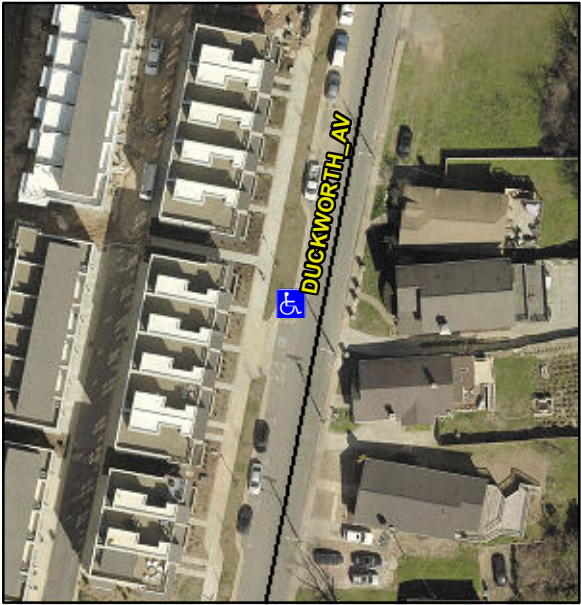