


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15555	Main Street: EASTOVER RIDGE DR	Cross Street: RANDOLPH RD	Location: W
ADA ID: B176FD8D6D8C	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 12.75			

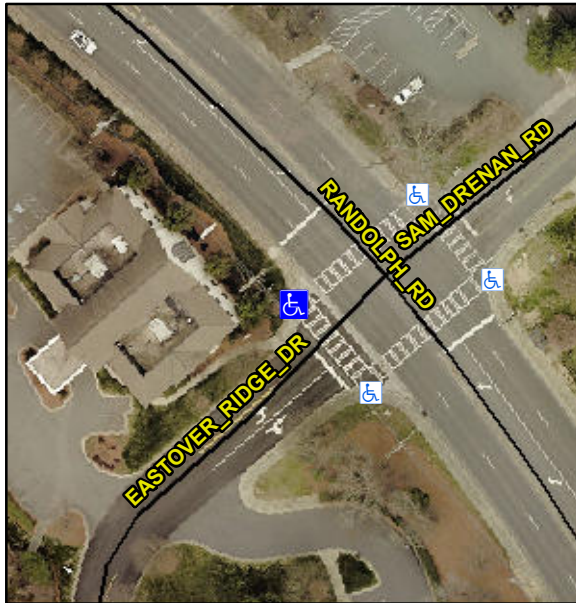

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	70.5	Yes	Ramp Slope (%)	7.2
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.9	Yes	Flare Slope RT (%)	3.8
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.5
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	88.0	N/A	X Walk 2 Width (in)	101.5
	X Walk 1 Slope (%)	3.3		X Walk 2 Slope (%)	4.1
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	4.9
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.5	N/A	Clear Space?	Yes
	Road X Slope (%)	0.9	Yes	Clear Space to XWalk (in)	111.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

