

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

13.5

60.0

5.4

2.9

1.9

2.1

N/A

Intersection ID: 48944Main Street: LILLYSHIRE_PLCross Street: CALDWELL_RIDGE_PYLocation:SWADA ID: B3AEE6E8EB53Ramp Type: Combination2Initial Pass/Fail: FailOverall Compliance: NoSeverity Score:10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance



Street 1 Name
StopSign
Stop Condition-Street 1
CALDWELL RIDGE PY
Street 2 Name
N/A
Stop Condition-Street 2
N/A

Possible Solutions:

Remove & Replace Entire Ramp.


Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost: \$ 1600.00

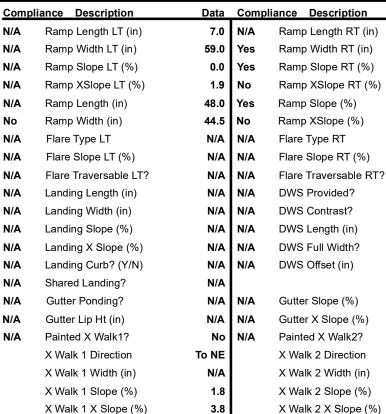

N/A

N/A


N/A N/A

N/A

Ramp inside XWalk1?

Road Slope (%)

Road X Slope (%)

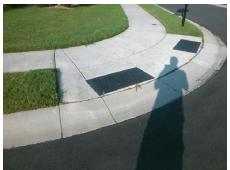





N/A

	ordan oparo to Attrant (iii)	
N/A	Any Obstruction?	N/A
	Obstruction Type	
		N/A
N/A	Storm Grate/Utility Hazard?	N/A
	Storm Grate/Utility Type	
		N/A
Yes	Surface Condition? (G/P)	Good
	Curb Slope (%)	35.0

Ramp inside XWalk2?

Clear Space to XWalk (in)

Clear Space?