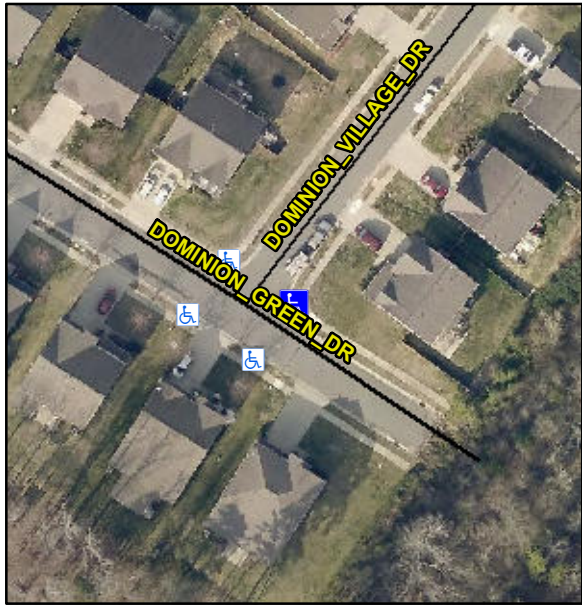


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47465	Main Street: DOMINION_VILLAGE_DR	Cross Street: DOMINION_GREEN_DR	Location: E
ADA ID: B42A460DDD96	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	50.0	Yes	Ramp Slope (%)	7.2
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.3
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	8.5	Yes	Flare Slope RT (%)	2.4
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			No	Landing Length (in)	45.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	0.2	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	4.8	Yes	DWS Full Width?	Yes
Surveyor Notes:			N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	8.0
PROW/ADA:			N/A	Shared Landing?	No			
Not Found, R304.5.3, R304.2.1, R305.2, R302.7.2			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.4
			No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.3
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	5.7		X Walk 2 Slope (%)	1.3
				X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	5.3
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	3.0	N/A	Clear Space?	Yes
				Road X Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
								</

