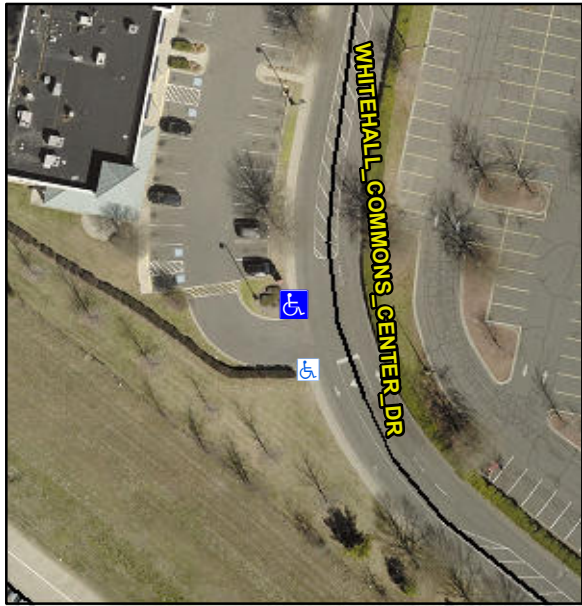


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A		Main Street: YORK_CENTER		Cross Street: N/A		Location:		NW							
ADA ID: B44505A9C260		Ramp Type: Directional2		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 10							
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance											
<div></div> <div>Possible Solutions:</div> <div>Remove &amp; Replace Entire Ramp.</div> <div>Surveyor Notes:</div> <div>N/A</div> <div>PROW/ADA:</div> <div>R304.5.1</div> <div>Street 1 Name    WHITEHALL COMMONS CENTER DR</div> <div>Stop Condition-Street 1                    None</div> <div>Street 2 Name                                N/A</div> <div>Stop Condition-Street 2                    N/A</div> <div>Total Cost:                                \$        1800.00</div>				Compliance		Description		Data		Compliance		Description		Data	
				N/A		Ramp Length (in)		49.0		N/A		Grade Break?		N/A	
				No		Ramp Width (in)		39.0		N/A		Grade Break Slope (%)		0.0	
				Yes		Ramp Slope (%)		1.6		N/A		Grade Break XSlope (%)		0.0	
				Yes		Ramp XSlope (%)		3.7							
				N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A	
				N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		0.0	
				N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A	
				N/A		Landing Length (in)		0.0		N/A		DWS Provided?		N/A	
				N/A		Landing Width (in)		0.0		N/A		DWS Contrast?		N/A	
				N/A		Landing Slope (%)		0.0		N/A		DWS Length (in)		N/A	
				N/A		Landing X Slope (%)		0.0		N/A		DWS Full Width?		N/A	
				N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset LT (in)		N/A	
				N/A		Shared Landing?		N/A		N/A		DWS Offset RT (in)		N/A	
				N/A		Gutter Ponding?		0.0		N/A		Gutter Slope (%)		N/A	
				N/A		Gutter Lip Ht (in)		0.0		N/A		Gutter X Slope (%)		N/A	
				N/A		Painted X Walk1?		No				Road Slope (%)		0.2	
						X Walk 1 Direction		To S				Road X Slope (%)		6.0	
						X Walk 1 Width (in)		N/A				Clear Space?		N/A	
						X Walk 1 Slope (%)		0.2		N/A		Clear Space to XWalk (in)		N/A	
		X Walk 1 X Slope (%)		6.0		N/A		Storm Grate/Utility Hazard?		N/A					
N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type							
N/A		Any Obstructions?		N/A						N/A					
		Obstruction Type				Yes		Surface Condition? (G/P)		Good					
						N/A		N/A		Curb Slope (%)		15.3			