

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14189	Main Street: E_KINGSTON_AV	Cross Street: EUCLID_AV	Location:	N
ADA ID: B469BCCAAC52	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 30

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

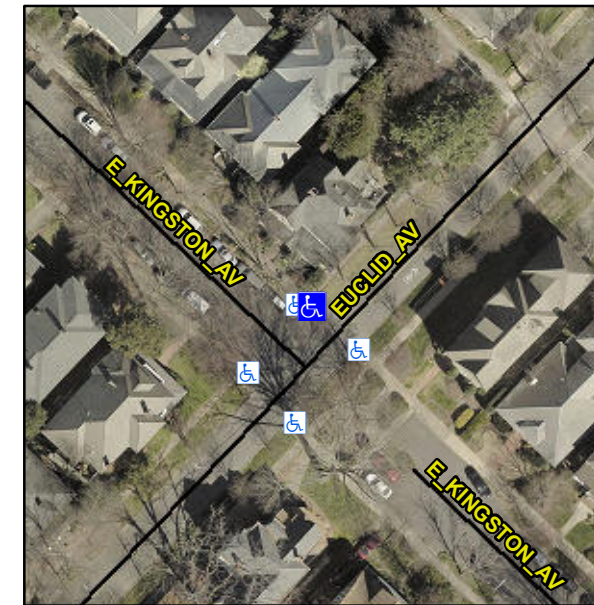

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.3, R305, R302.7, R302.7.2,
R304.5.4**

Street 1 Name	EUCLID AV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	26.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	55.0	Yes	Grade Break Slope (%)	3.8
Yes	Ramp Slope (%)	6.8	Yes	Grade Break XSlope (%)	1.7
Yes	Ramp XSlope (%)	1.0			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.3	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	50.0	No	DWS Provided?	No
Yes	Landing Width (in)	58.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.3	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	No	N/A	DWS Offset RT (in)	N/A
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	6.6
No	Gutter Lip Ht (in)	1.0	No	Gutter X Slope (%)	4.0
N/A	Painted X Walk1?	No		Road Slope (%)	9.1
	X Walk 1 Direction	To SE		Road X Slope (%)	1.6
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	9.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.6	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.4

