

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52336	Main Street: WOODWARD_AV	Cross Street: KOHLER_AV	Location:	N
ADA ID: B4B86DD129AC	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 7.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

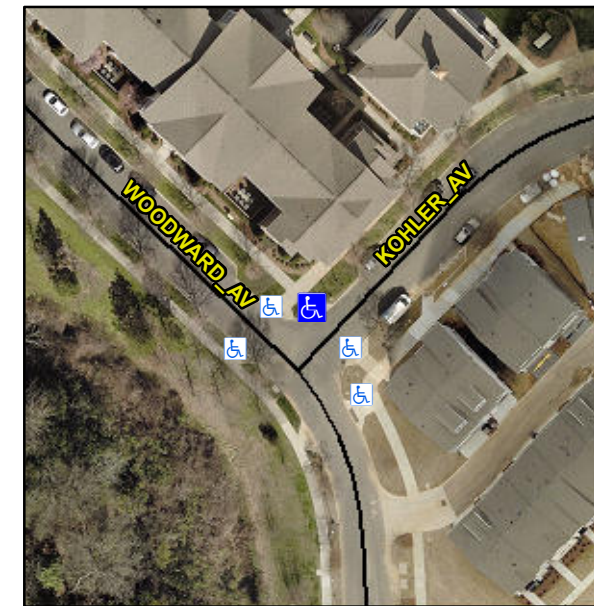

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.1.4, R305.2, R302.7, R302.7.2, R304.5.3

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	138.0	Yes	BlendTrans Slope (%)	4.4
Yes	Ramp Width (in)	71.0	Yes	BlendTrans XSlope (%)	2.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	11.1	N/A	Flare Slope RT (%)	0.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	96.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	No	DWS Length (in)	23.5
Yes	Landing X Slope (%)	1.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	1.1
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	3.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.7		Clear Space?	Yes
	Road X Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	20.5

Street 1 Name KOHLER AV
 Stop Condition-Street 1 StopSign
 Street 2 Name N/A
 Stop Condition-Street 2 N/A

