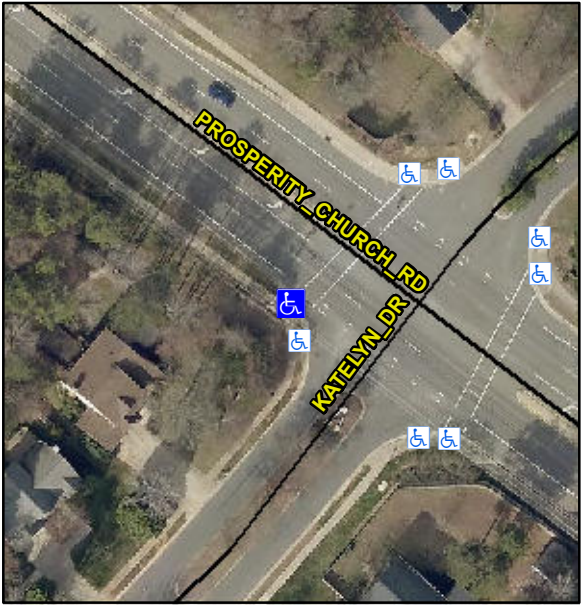


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3373	Main Street: KATELYN_DR	Cross Street: PROSPERITY_CHURCH_RD	Location: W
ADA ID: B4DCB5648DA7	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Remove & Replace Gutter.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	R304.5.3, R304.2.1, R304.2.2-Perp,				
	R304.3.2-Para, R305				
Street 1 Name	PROSPERITY CHURCH RD				
Stop Condition-Street 1	None				
Street 2 Name	N/A				
Stop Condition-Street 2	N/A				
Total Cost:		\$	2350.00		

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	51.5	N/A	Ramp Length RT (in)	57.5
Yes	Ramp Width LT (in)	59.0	Yes	Ramp Width RT (in)	57.5
Yes	Ramp Slope LT (%)	5.8	Yes	Ramp Slope RT (%)	5.5
Yes	Ramp XSlope LT (%)	1.7	No	Ramp XSlope RT (%)	2.1
Yes	Landing Length (in)	107.5	No	DWS Provided?	No
No	Landing Width (in)	33.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	5.2	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.2	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.9
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.5
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	113.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	12.3

