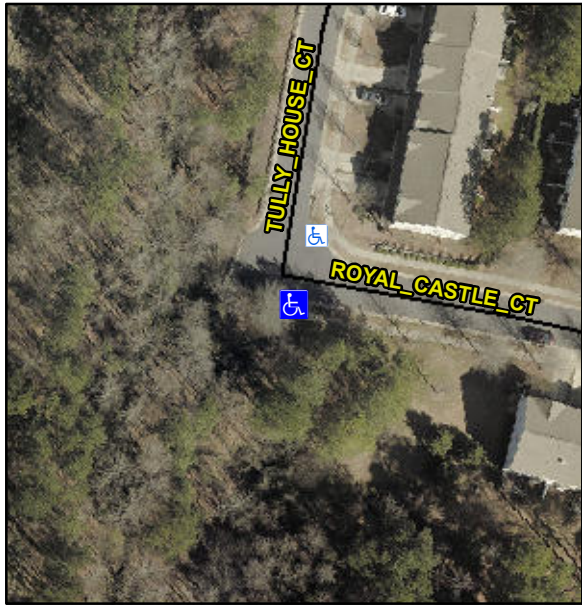


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48018	Main Street: ROYAL_CASTLE_CT	Cross Street: TULLY_HOUSE_CT	Location: S
ADA ID: B4E484870716	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	6.5
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.3
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	6.5	Yes	Flare Slope RT (%)	0.2
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			Yes	Landing Length (in)	48.5	No	DWS Provided?	No
			Yes	Landing Width (in)	49.5	N/A	DWS Contrast?	No
			No	Landing Slope (%)	2.5	N/A	DWS Length (in)	N/A
			Yes	Landing X Slope (%)	2.2	N/A	DWS Full Width?	No
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305</p>			N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.7
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	2.8		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Street 1 Name		ROYAL CASTLE CT		Road Slope (%)	N/A	N/A	Clear Space?	Yes
Stop Condition-Street 2		None		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Street 2 Name		N/A	Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
Stop Condition-Street 1		N/A		Obstruction Type			Storm Grate/Utility Type	
Total Cost:		\$ 1850.00			N/A			N/A
						Yes	Surface Condition? (G/P)	Good

