


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 13450	Main Street: S_MCDOWELL_ST	Cross Street: E_MARTIN_LUTHER_KING_JR_BV	Location: E
ADA ID: B5A4BD22AEE6	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

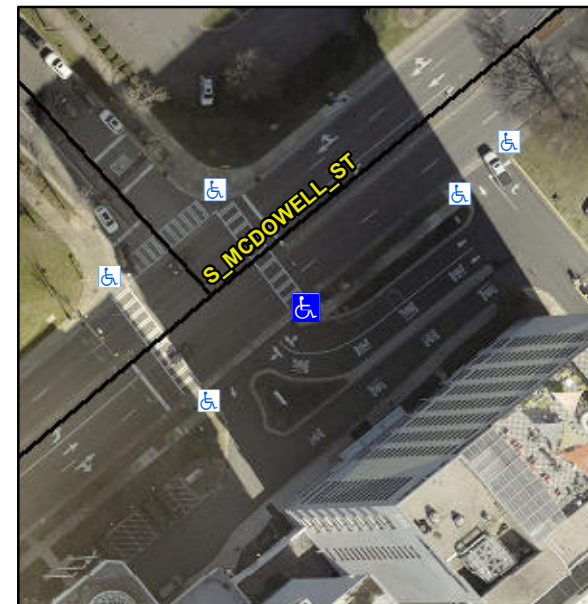

Street 1 Name	S MCDOWELL ST
Stop Condition-Street 1	Signal
Street 2 Name	MARTIN LUTHER KING JR BV
Stop Condition-Street 2	Signal

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	Yes	BlendTrans Slope (%)	4.5
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.9	N/A	Flare Slope RT (%)	4.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	8.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To S
	X Walk 1 Width (in)	110.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	3.9
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	0.8
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.5		Clear Space?	Yes
	Road X Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	7.7

