

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 10023160 Main Street: CHARLOTTE_VIEW_DR Cross Street: N/A Location: S

ADA ID: B5AED1C7E798 Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

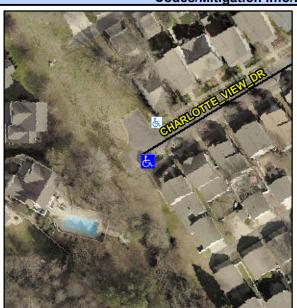

Street 1 Name	CHARLOTTE VIEW DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2

Total Cost: \$ 1850.00

Fleid Measurements/Component Compliance							
Compliance Description		Data	Compliance Description		Data		
N/A	Ramp Length (in)	60.0	No	Ramp Slope (%)	11.6		
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.8		
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	4.2		X Walk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm Grate/Utility Type			
		N/A			N/A		
			Yes	Surface Condition? (G/P)	Good		
1800	459						





