


Intersection ID: 42785	Main Street: CALDWELL_RD	Cross Street: OLD_STONE_CROSSING_DR	Location:	E
ADA ID: B6B55F72D6A4	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

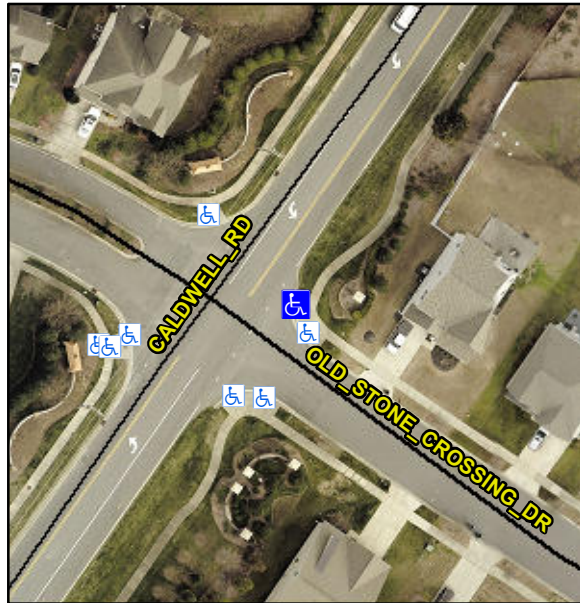

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.3.2

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Entire Ramp.			N/A	Ramp Length LT (in)	14.0	N/A	Ramp Length RT (in)	13.0
			Yes	Ramp Width LT (in)	58.0	Yes	Ramp Width RT (in)	60.0
			No	Ramp Slope LT (%)	8.5	Yes	Ramp Slope RT (%)	5.8
			Yes	Ramp XSlope LT (%)	0.9	Yes	Ramp XSlope RT (%)	0.0
			N/A	Ramp Length (in)	71.5	Yes	Ramp Slope (%)	0.4
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.8
Surveyor Notes: N/A			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
PROW/ADA: Not Found, R304.5.3, R304.3.2			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	N/A
Total Cost: \$ 1800.00			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A		Clear Space?	N/A
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A

Total Cost: \$ 1800.00



Compliance	Description	Data
N/A	Ramp Length RT (in)	13.0
Yes	Ramp Width RT (in)	60.0
Yes	Ramp Slope RT (%)	5.8
Yes	Ramp XSlope RT (%)	0.0
Yes	Ramp Slope (%)	0.4
No	Ramp XSlope (%)	4.8
N/A	Flare Type RT	N/A
N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable RT?	N/A
N/A	DWS Provided?	N/A
N/A	DWS Contrast?	N/A
N/A	DWS Length (in)	N/A
N/A	DWS Full Width?	N/A
N/A	DWS Offset (in)	N/A
N/A	Gutter Slope (%)	N/A
N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk2?	N/A
N/A	X Walk 2 Direction	N/A
N/A	X Walk 2 Width (in)	N/A
N/A	X Walk 2 Slope (%)	N/A
N/A	X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk2?	N/A
N/A	Clear Space?	N/A
N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstruction?	N/A
N/A	Obstruction Type	N/A
N/A	Storm Grate/Utility Hazard?	N/A
N/A	Storm Grate/Utility Type	N/A
Yes	Surface Condition? (G/P)	Good
Yes	Curb Slope (%)	11.9