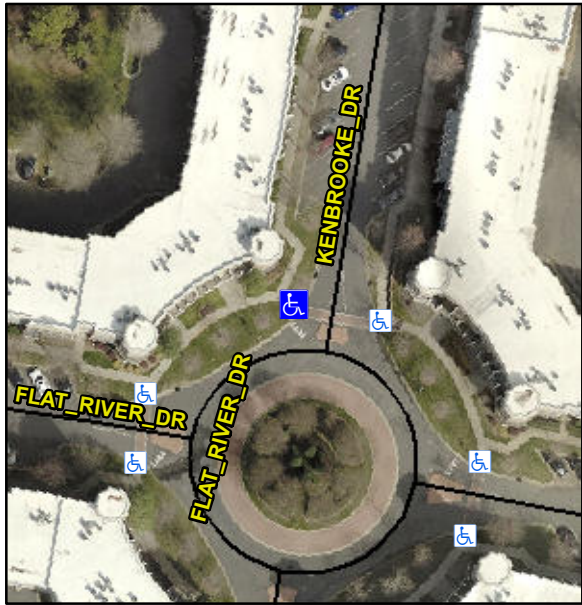


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 47396	Main Street: FLAT_RIVER_DR	Cross Street: FLAT_RIVER_DR	Location:	N
ADA ID: B6CCECB16BA2	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 12.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		N/A	Ramp Length (in)	58.5	No	Ramp Slope (%)	8.7
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.7
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:	<b>N/A</b>		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To E		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	51.0	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	6.7		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	6.0		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
PROW/ADA:	<b>R304.2.2</b>			Road Slope (%)	N/A	N/A	Clear Space?	N/A
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
	Total Cost:		\$	1850.00				

