


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9159	Main Street: CAMPUS_ST	Cross Street: TATE_ST	Location: NE
ADA ID: B73944F924D5	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 15
			Field Measurements/Component Compliance

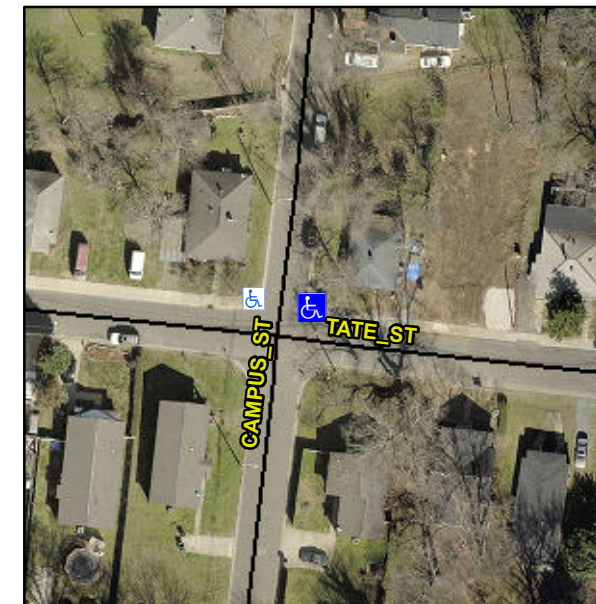

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.5.3, R305, R304.5.4

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	N/A	N/A	Ramp Length RT (in)	57.0
N/A	Ramp Width LT (in)	N/A	Yes	Ramp Width RT (in)	52.0
N/A	Ramp Slope LT (%)	N/A	Yes	Ramp Slope RT (%)	7.0
N/A	Ramp XSlope LT (%)	N/A	Yes	Ramp XSlope RT (%)	0.0
Yes	Landing Length (in)	61.0	No	DWS Provided?	No
No	Landing Width (in)	29.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	0.9	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.7	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	17.0

