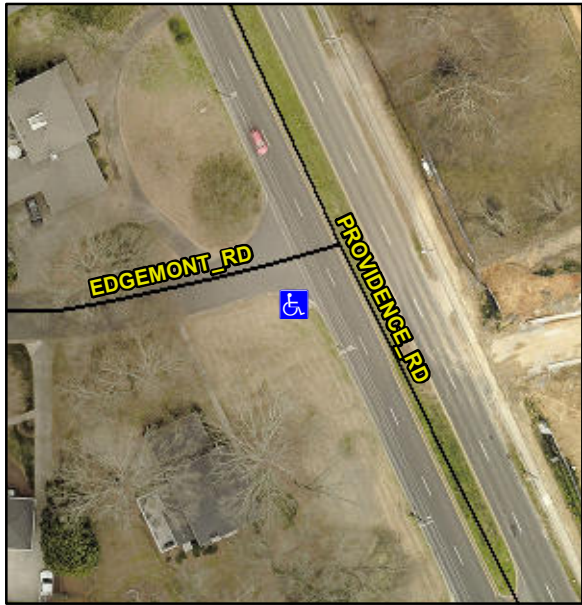


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 19143	Main Street: EDMONT_RD	Cross Street: PROVIDENCE_RD	Location: SW
ADA ID: B7DAB69382DD	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 18.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length LT (in)	59.0	N/A	Ramp Length RT (in)	60.0
			No	Ramp Width LT (in)	33.0	No	Ramp Width RT (in)	33.0
			Yes	Ramp Slope LT (%)	5.2	Yes	Ramp Slope RT (%)	7.4
			No	Ramp XSlope LT (%)	2.8	No	Ramp XSlope RT (%)	4.3
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
Surveyor Notes:			N/A	Shared Landing?	N/A			
PROW/ADA:			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
<b>R304.5.1, R304.5.3</b>			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	5.3
				X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	0.0
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	1.4	N/A	Clear Space?	N/A
				Road X Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	12.9
Total Cost:		\$	3200.00					
Street 1 Name		PROVIDENCE RD						
Stop Condition-Street 1		None						
Street 2 Name		EDGEMONT RD						
Stop Condition-Street 2		StopSign						

