

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 19146	Main Street: TYVOLA_RD	Cross Street: WEDGEWOOD_DR	Location: SE
ADA ID: B8B6C7DA2371	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

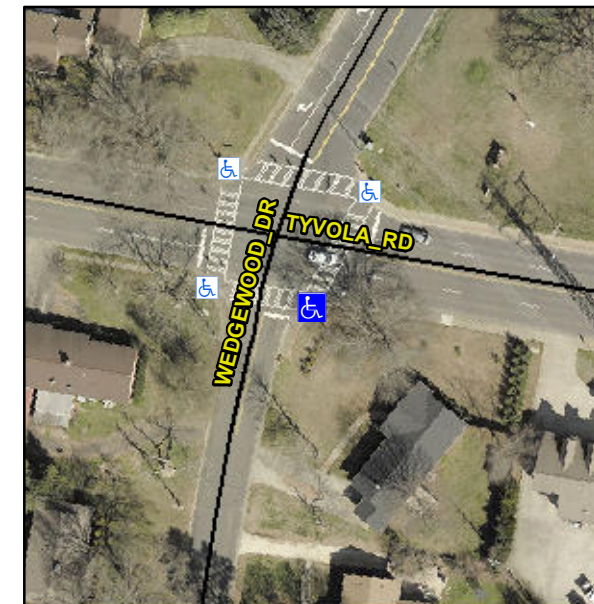

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	24.0	Yes	Ramp Slope (%)	6.4
Yes	Ramp Width (in)	125.0	No	Ramp XSlope (%)	2.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.8	Yes	Flare Slope RT (%)	1.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	32.0	No	DWS Provided?	No
Yes	Landing Width (in)	125.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.4	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.2	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	3.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.3
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	108.0	N/A	X Walk 2 Width (in)	106.0
	X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	4.0
	X Walk 1 X Slope (%)	4.0		X Walk 2 X Slope (%)	3.1
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.3	N/A	Clear Space?	Yes
	Road X Slope (%)	4.9	Yes	Clear Space to XWalk (in)	72.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name TYVOLA RD
 Stop Condition-Street 2 Signal
 Street 2 Name WEDGEWOOD DR
 Stop Condition-Street 1 Signal

