


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 25823	Main Street: BANNINGTON_RD	Cross Street: PINEVILLE-MATTHEWS_RD	Location:	SE
ADA ID: B8C74CD7E63B	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 15
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

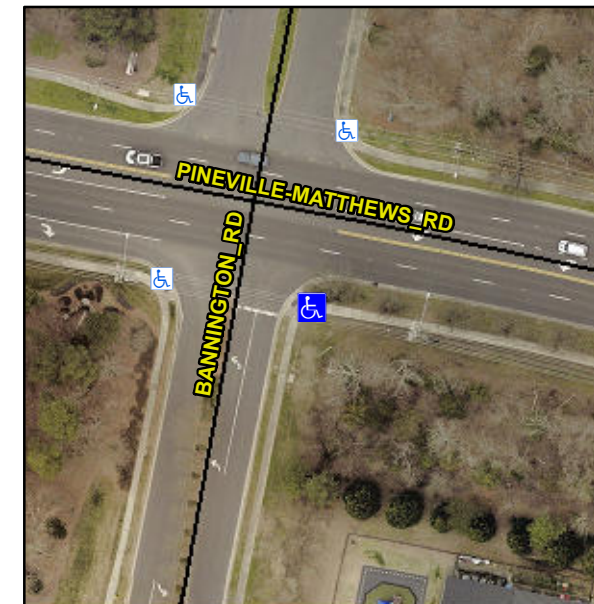

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	61.0	Yes	BlendTrans Slope (%)	4.0
Yes	Ramp Width (in)	55.0	Yes	BlendTrans XSlope (%)	1.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.8	N/A	Flare Slope RT (%)	3.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	63.0	No	DWS Provided?	No
Yes	Landing Width (in)	58.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.7	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	11.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	4.4
	X Walk 1 X Slope (%)	6.1		X Walk 2 X Slope (%)	2.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.2		Clear Space?	Yes
	Road X Slope (%)	6.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	12.4

