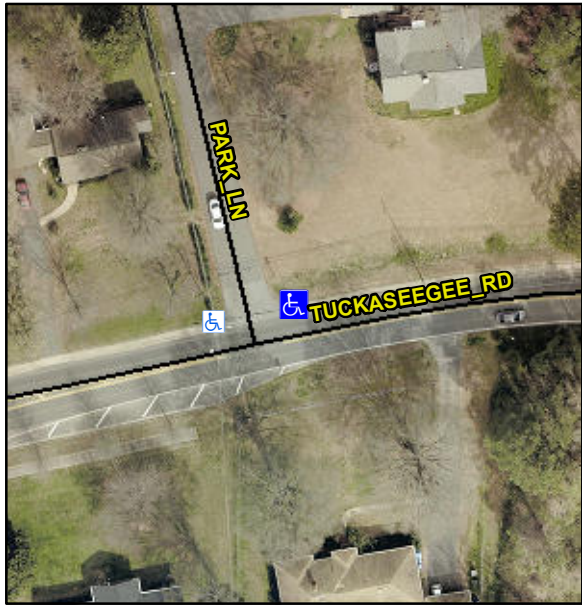


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 9709	Main Street: PARK_LN	Cross Street: TUCKASEEGEE_RD	Location:	E
ADA ID: B91CDF212988	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 22.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance									
	Possible Solutions:		<b>Compliance</b>			<b>Description</b>			<b>Data</b>			
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length (in)		<b>86.5</b>	<b>N/A</b>	Grade Break?		<b>N/A</b>		
			<b>No</b>	Ramp Width (in)		<b>37.0</b>	<b>N/A</b>	Grade Break Slope (%)		<b>0.0</b>		
			<b>No</b>	Ramp Slope (%)		<b>11.5</b>	<b>N/A</b>	Grade Break XSlope (%)		<b>0.0</b>		
			<b>No</b>	Ramp XSlope (%)		<b>2.1</b>						
			<b>N/A</b>	Flare Type LT		<b>N/A</b>	<b>N/A</b>	Flare Type RT		<b>N/A</b>		
			<b>N/A</b>	Flare Slope LT (%)		<b>N/A</b>	<b>N/A</b>	Flare Slope RT (%)		<b>0.0</b>		
			<b>N/A</b>	Flare Traversable LT?		<b>N/A</b>	<b>N/A</b>	Flare Traversable RT?		<b>N/A</b>		
	Surveyor Notes:		<b>N/A</b>	<b>N/A</b>	Landing Length (in)		<b>0.0</b>	<b>N/A</b>	DWS Provided?		<b>N/A</b>	
				<b>N/A</b>	Landing Width (in)		<b>0.0</b>	<b>N/A</b>	DWS Contrast?		<b>N/A</b>	
			<b>N/A</b>	Landing Slope (%)		<b>0.0</b>	<b>N/A</b>	DWS Length (in)		<b>N/A</b>		
			<b>N/A</b>	Landing X Slope (%)		<b>0.0</b>	<b>N/A</b>	DWS Full Width?		<b>N/A</b>		
PROW/ADA:			<b>N/A</b>	Landing Curb? (Y/N)		<b>N/A</b>	<b>N/A</b>	DWS Offset LT (in)		<b>N/A</b>		
<b>R304.5.1, R304.2.2, R304.5.3</b>			<b>N/A</b>	Shared Landing?		<b>N/A</b>	<b>N/A</b>	DWS Offset RT (in)		<b>N/A</b>		
			<b>N/A</b>	Gutter Ponding?		<b>0.0</b>	<b>N/A</b>	Gutter Slope (%)		<b>N/A</b>		
			<b>N/A</b>	Gutter Lip Ht (in)		<b>0.0</b>	<b>N/A</b>	Gutter X Slope (%)		<b>N/A</b>		
			<b>N/A</b>	Painted X Walk1?		<b>No</b>		Road Slope (%)		<b>2.6</b>		
				X Walk 1 Direction		<b>To W</b>		Road X Slope (%)		<b>4.6</b>		
				X Walk 1 Width (in)		<b>N/A</b>		Clear Space?		<b>N/A</b>		
				X Walk 1 Slope (%)		<b>2.6</b>	<b>N/A</b>	Clear Space to XWalk (in)		<b>N/A</b>		
				X Walk 1 X Slope (%)		<b>4.6</b>	<b>N/A</b>	Storm Grate/Utility Hazard?		<b>N/A</b>		
			<b>N/A</b>	Ramp inside XWalk1?		<b>N/A</b>		Storm Grate/Utility Type				
			<b>N/A</b>	Any Obstructions?		<b>N/A</b>				<b>N/A</b>		
				Obstruction Type			<b>Yes</b>	Surface Condition? (G/P)		<b>Good</b>		
						<b>N/A</b>	<b>N/A</b>	Curb Slope (%)		<b>0.1</b>		
Street 1 Name		<b>PARK LN</b>										
Stop Condition-Street 1		<b>StopSign</b>										
Street 2 Name		<b>N/A</b>										
Stop Condition-Street 2		<b>N/A</b>										
Total Cost:		<b>\$ 1600.00</b>										

