


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12056	Main Street: ELLIOTT_ST	Cross Street: W_MOREHEAD_ST	Location: SE
ADA ID: B93EF9F2AF79	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

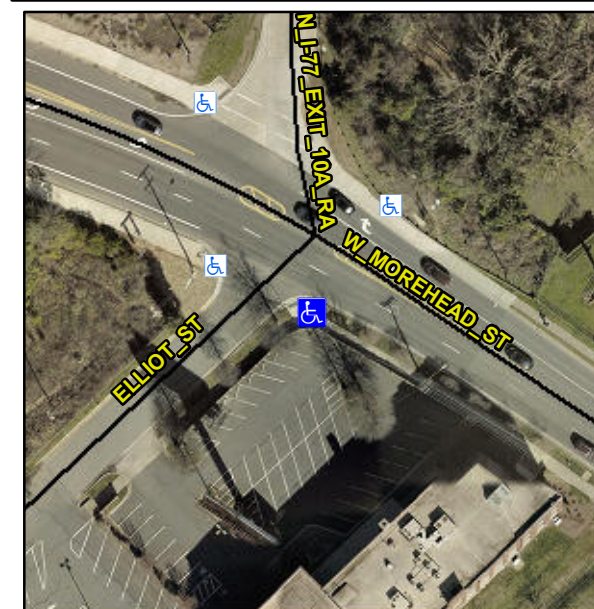

Possible Solutions:

Remove & Replace Detectable Warning System.

Surveyor Notes:

LNDG LINE IS NOT PERP TO RAMP

PROW/ADA:

R305.2

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	92.0	Yes	BlendTrans Slope (%)	4.7
Yes	Ramp Width (in)	69.0	Yes	BlendTrans XSlope (%)	1.7
Yes	Flare Type	LCurbed_NoWalkSurface	Yes	Flare Type	RCurbed_NoWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	69.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	64.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.9	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.5		X Walk 2 Slope (%)	1.6
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5		Clear Space?	Yes
	Road X Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	2.7

Street 1 Name W MOREHEAD ST

Stop Condition-Street 1 None

Street 2 Name ELLIOTT ST

Stop Condition-Street 2 StopSign

