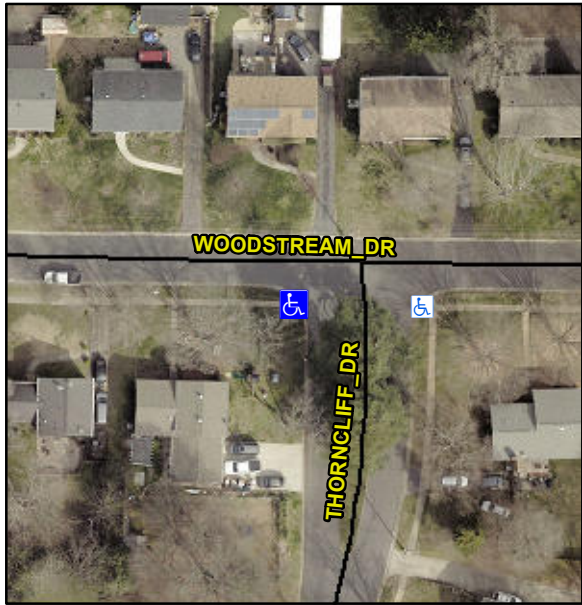


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 21451		Main Street: THORNCLIFF_DR		Cross Street: WOODSTREAM_DR		Location: SW			
ADA ID: B944CD33E23B		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 7.5	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
 Possible Solutions: Remove & Replace Landing. Remove & Replace Gutter. Surveyor Notes: N/A PROW/ADA: R304.2.1, R304.5.3, R302.7.2 Street 1 Name THORNCLIFF DR Stop Condition-Street 1 StopSign Street 2 Name N/A Stop Condition-Street 2 N/A				Compliance	Description	Data	Compliance	Description	Data
				N/A	Ramp Length (in)	24.0	Yes	Grade Break?	Yes
				Yes	Ramp Width (in)	48.0	Yes	Grade Break Slope (%)	1.7
				Yes	Ramp Slope (%)	1.8	Yes	Grade Break XSlope (%)	0.2
				Yes	Ramp XSlope (%)	0.8			
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	6.0	Yes	Flare Slope RT (%)	0.0
				N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
				Yes	Landing Length (in)	54.0	Yes	DWS Provided?	Yes
				No	Landing Width (in)	46.5	Yes	DWS Contrast?	Yes
				Yes	Landing Slope (%)	2.0	Yes	DWS Length (in)	24.0
				No	Landing X Slope (%)	2.1	Yes	DWS Full Width?	Yes
				N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	30.0
				N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.3
				No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	2.1
				N/A	Painted X Walk1?	No		Road Slope (%)	4.2
					X Walk 1 Direction	To E		Road X Slope (%)	0.2
					X Walk 1 Width (in)	N/A		Clear Space?	Yes
					X Walk 1 Slope (%)	4.2	N/A	Clear Space to XWalk (in)	N/A
					X Walk 1 X Slope (%)	0.2	Yes	Storm Grate/Utility Hazard?	No
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
				Yes	Any Obstructions?	No			N/A
					Obstruction Type		Yes	Surface Condition? (G/P)	Good
							N/A	Curb Slope (%)	2.0

Total Cost: \$ 1250.00

