


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 16112	Main Street: ANSON_ST	Cross Street: HARTFORD_AV	Location: N
ADA ID: B95D3ED7AC28	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 0			

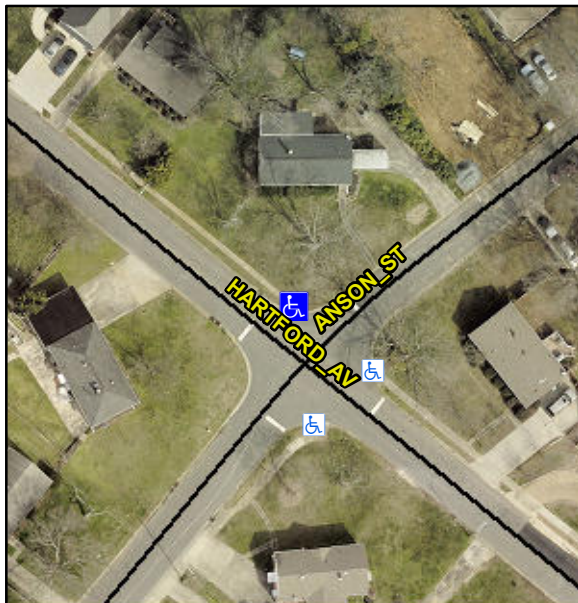

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-  
Para, R304.5.2, R305.2, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	30.0	No	Grade Break?	No
Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	5.3
Yes	Ramp Slope (%)	6.4	N/A	Grade Break XSlope (%)	0.6
Yes	Ramp XSlope (%)	1.8			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.4	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	10.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	80.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.8
N/A	Painted X Walk1?	No		Road Slope (%)	3.0
	X Walk 1 Direction	To SE		Road X Slope (%)	4.7
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.0	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.7	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	23.8

Total Cost: \$ 2350.00

