

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Data

40.5

52.5

9.2

1.7

5.6

7.3

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Main Street: AVENSONG CROSSING DR **Cross Street: CHANTRESS LN** Location: Intersection ID: 11285 SW Initial Pass/Fail: Fail **Overall Compliance: No** ADA ID: B97952E49004 Ramp Type: Combination1 **Severity Score:** 37.5

**Codes/Mitigation Info/Possible Solution** 

## **Field Measurements/Component Compliance**

N/A

Yes

No

Yes

Yes

No

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp XSlope RT (%)

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Flare Traversable RT?

Flare Type RT

Data

31.0

48.0

5.7

2.6

41.0

53.0

N/A

Flare Traversable LT?

Ramp XSlope LT (%)




StopSign Street 1 Name **CHANTRESS LN** Stop Condition-Street 1 Street 2 Name N/A Stop Condition-Street 2 N/A

Possible Solution		rieia ivie	
Possible Solutions:	Comp	Compliance Description	
Remove & Replace Entire Ramp.	N/A	Ramp Length LT (in)	
	Yes	Ramp Width LT (in)	
	Yes	Ramp Slope LT (%)	
	No	Ramp XSlope LT (%	
	N/A	Ramp Length (in)	
	Yes	Ramp Width (in)	
Surveyor Notes:	N/A	Flare Type LT	
CURB WIDTH 43.0, CURB GAP 1.5	N/A	Flare Slope LT (%)	
	N/A	Flare Traversable LT	
	N/A	Landing Length (in)	
	N/A	Landing Width (in)	
PROW/ADA:	N/A	Landing Slope (%)	
Not Found, R304.5.3, R304.3.2	N/A	Landing X Slope (%)	
	N/A	Landing Curb? (Y/N)	
	N/A	Shared Landing?	
	N/A	Gutter Ponding?	
	N/A	Gutter Lip Ht (in)	
	N/A	Painted X Walk1?	
		X Walk 1 Direction	
		X Walk 1 Width (in)	
		X Walk 1 Slope (%)	
		X Walk 1 X Slope (%	





Total Cost:

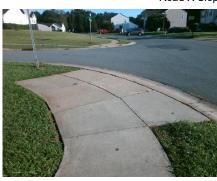

	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
		X Walk 1 Direction	To N		X Walk 2 Direction	N/A	
		X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A	
		X Walk 1 Slope (%)	5.7		X Walk 2 Slope (%)	N/A	
		X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	N/A	
1800.00	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
		Road Slope (%)	N/A		Clear Space?	N/A	
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
Marie Marie		1 1 1		N/A	Any Obstruction?	N/A	
					Obstruction Type		
And beginning						N/A	
				N/A	Storm Grate/Utility Hazard?	N/A	
				l	Storm Grate/Utility Type	14,7 4	
A						N/A	
	1			Yes	Surface Condition? (G/P)	Good	
					Curb Slope (%)	17.8	
THE RESERVE OF THE PERSON OF T	The Part of the Pa						