

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 42581	Main Street: GERALDINE_POWE_DR	Cross Street: RISING_OAK_DR	Location:	E
ADA ID: B9F0A9BF3B30	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 20

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

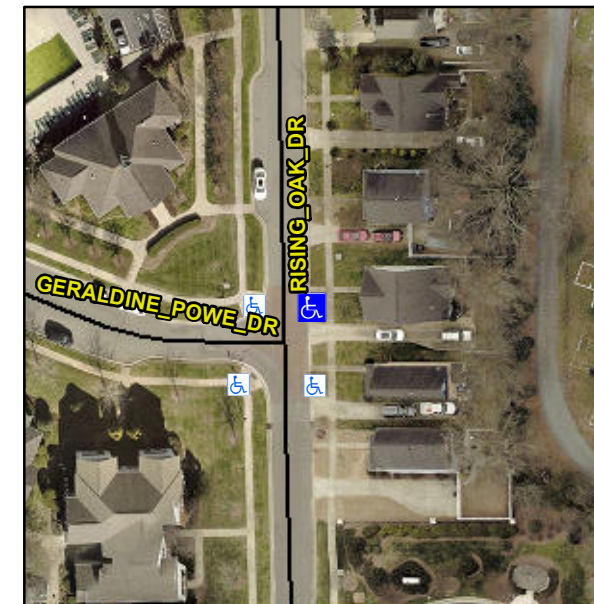

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**XWALK PAVERS**

PROW/ADA:

**Not Found, R305.2, R302.7, R302.7.2, R304.5.4**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	93.5	Yes	BlendTrans Slope (%)	4.6
Yes	Ramp Width (in)	49.5	Yes	BlendTrans XSlope (%)	1.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	4.3	N/A	Flare Slope RT (%)	8.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	49.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	2.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	7.8
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	2.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.0		Clear Space?	Yes
	Road X Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	14.0

