


Intersection ID: 54616	Main Street: RUMPLE_RD	Cross Street: UNIVERSITY_CITY_BV	Location:	NE
ADA ID: BA0882CF3A41	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	5.4
				No	Ramp Width (in)	47.5	Yes	Ramp XSlope (%)	0.5
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	Surveyor Notes:			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A				Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
PROW/ADA:			N/A	Shared Landing?	N/A				
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
				X Walk 1 Direction	To W		X Walk 2 Direction	To S	
Total Cost:			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
				X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	2.8	
				X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	3.7	
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
				Road Slope (%)	0.2	N/A	Clear Space?	N/A	
				Road X Slope (%)	4.1	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A	
						Yes	Surface Condition? (G/P)	Good	

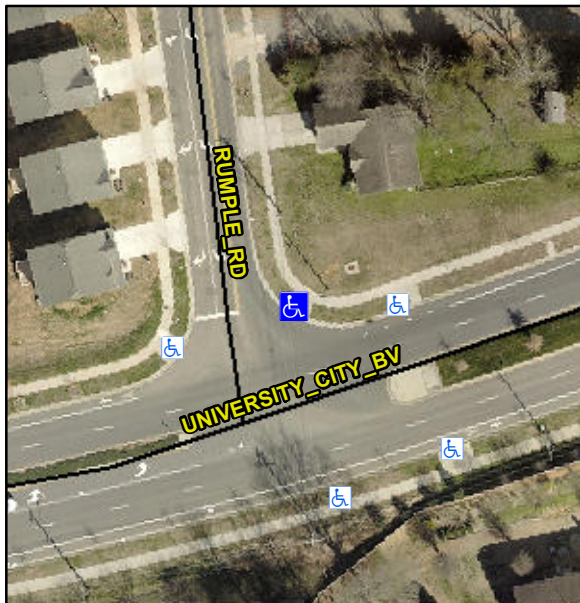